

# FABRICATION OF AN OXYGEN SENSOR AND ITS APPLICATION TO INVESTIGATE IRON ORE-CARBON REACTION

By

AVINASH KESHAV GOKHALE

ME

1975

M

GOK

FAB

TH  
me/1975/m  
GS61f



DEPARTMENT OF METALLURGICAL ENGINEERING

INDIAN INSTITUTE OF TECHNOLOGY KANPUR

# **FABRICATION OF AN OXYGEN SENSOR AND ITS APPLICATION TO INVESTIGATE IRON ORE-CARBON REACTION**

**A Thesis Submitted  
In partial Fulfilment of the Requirements  
for the Degree of  
MASTER OF TECHNOLOGY**

**By  
AVINASH KESHAV GOKHALE**

**to the**

**DEPARTMENT OF METALLURGICAL ENGINEERING  
INDIAN INSTITUTE OF TECHNOLOGY KANPUR  
AUGUST 1975**



117 AFUR  
CENTRAL LIBRARY  
Acc. No. A 45551.

1 FEB 1976

11  
56

ME-1978-M-GOK-FAB

## C E R T I F I C A T E

Certified that this work on "Fabrication of oxygen sensor using solid electrolyte technique and its application for the investigation of the iron ore-carbon reaction" has been carried out under my supervision and that it has not been submitted elsewhere for a degree.

*A. Ghosh*

A. Ghosh

Professor

Department of Metallurgical Engineering

Indian Institute of Technology

Kanpur-208016, U.P.

### POST GRADUATE OFFICE

This thesis has been approved  
for the award of the Degree of  
Master of Technology (M.Tech.)  
in accordance with the  
regulations of the Indian  
Institute of Technology Kanpur

Dated: 78 8 24

### ACKNOWLEDGEMENTS

I wish to express my sincere appreciation to Dr. A. Ghosh for suggesting this problem, for his able guidance and discussions throughout the course.

I am grateful to Dr. H.S. Ray for supplying the quartz tube, necessary for making the apparatus.

I am thankful to Dr. Ramnarayan for sparing the valuable platinum paste for platinization of the solid electrolyte tube.

I am also thankful to Dr. K.P. Sin Gupta and Dr. E.C. Subbarao for allowing me to use their microvoltmeters.

I must thank Mr. V.N. Sharma for providing the laboratory equipments from time to time.

I acknowledge Mr. A.K. Sengupta for the initiation of the work and assembling most of the parts necessary for fabrication of the oxygen sensor.

I am also thankful to Mr. N.B. Ballal for helping me a lot in computer programming.

Finally I would like to thank Mr. R.B. Singh for typing the thesis.

CONTENTS

PAGE NO.

ABSTRACT

CHAPTER I : INTRODUCTION

A) Objective of the work	1
B) Literature review	
B-1) Solid Electrolyte Oxygen sensor	1
B-2) Reduction of Iron ore by carbon	7
C) Plan of the work	15

CHAPTER II : APPARATUS

A) Oxygen sensor	18
B) Ore-Carbon reaction assembly	23

CHAPTER III : EXPERIMENTAL PROCEDURES AND MATERIALS

A) Procedure for testing the oxygen sensor	25
B) Reduction of Iron ore by graphite	27

CHAPTER IV : RESULTS AND DISCUSSIONS ON THE PERFORMANCE OF OXYGEN SENSOR

32

CHAPTER V : RESULTS OF IRON ORE-GRAPHITE REACTION

39

CHAPTER VI : DISCUSSIONS ON RESULTS OF IRON ORE-GRAPHITE REACTION

A) Reliability of the results	43
B) Correction to processed data	48
C) Interpretation of Ore-graphite powder mixture and pure $Fe_2O_3$ -graphite powder mixture.	55
D) Interpretation for Ore pellets- graphite powder mixtures	56

CHAPTER VII : SUMMARY AND CONCLUSIONS

60

BIBLIOGRAPHY

62

- APPENDIX I : Computer Programme
- APPENDIX II : Sample computer printouts assuming  
 $\text{CO-C}_2\text{H}_2\text{-O}_2$  equilibrium at oxygen  
sensor temperature.
- APPENDIX III : Sample computer printouts assuming  
 $\text{CO-CO}_2\text{-O}_2$  equilibrium to be 'frozen'  
at reaction temperature.
- APPENDIX IV : Tables of the results of the  
experiments.
- APPENDIX V : Theoretical calculations for the  
reduction of pellets assuming  
reduction stage to be rate cont-  
rolling.
-

## CHAPTER I

INTRODUCTION AND LITERATURE REVIEWA) Objective of the work:

Oxygen sensor based on solid electrolyte cell is a versatile device in measuring and monitoring the oxygen concentration in gases or liquids. The response of the sensor to the change in oxygen concentration is very quick (less than 1 sec.) and the range over which it can be used is very wide. This sensor can be employed for chemical analysis of some gas mixtures as well. Due to these outstanding advantages, the use of this sensor on the commercial scale for various applications is coming up fast in the industrially advanced countries. Since this has not become a common feature in India, it was planned to fabricate an oxygen sensor for gases only, to test<sub>hh</sub> its performance and to use it for laboratory investigations.

The reaction between iron ore and graphite is an important reaction in blast furnace and also in the rotary kiln process of sponge iron making, which offers an important alternative method for iron production. The course of such a reaction can, in principle, be followed by measuring the rates of generation of CO and CO<sub>2</sub>. The latter could be determined by monitoring the flow-rate of the gas mixture coming out of the reaction chamber and analysing its CO/CO<sub>2</sub> ratio by the solid electrolyte oxygen sensor. Therefore it was chosen for investigation.

B) Literature Review:B-1) Solid Electrolyte Oxygen Sensor:

The review shall be restricted to sensors to be employed




for gases.

Solid electrolyte, are solids which allow ionic conduction only. For the oxygen sensor the materials which conduct oxygen ions are of interest. Again the ionic conduction should be very close to 100 pct. if it has to be useful as an electrolyte in a galvanic cell. For this  $\text{ZrO}_2\text{-CaO}$ ,  $\text{ZrO}_2\text{-MgO}$ ,  $\text{ZrO}_2\text{-Y}_2\text{O}_3$ ,  $\text{ThO}_2\text{-Y}_2\text{O}_3$  have been employed. But calcia stabilized zirconia,  $\text{ZrO}_2\text{-CaO}$  (CSZ in abbreviation) is the most important one.

A number of review articles have already appeared in the literature (1-4). Therefore the following discussion would be brief.

#### B- 1-1 ) Principle of operation of oxygen sensor:

Using the CSZ, an oxygen concentration cell is formed as shown below.

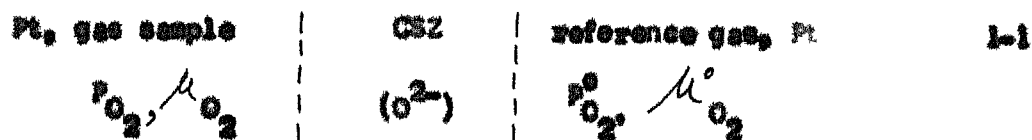

$$\text{For this cell } E = \frac{\Delta G^0}{2F}$$

$$\therefore E = \frac{RT}{2F} \ln \frac{P_{\text{O}_2}^0}{P_{\text{O}_2}} \quad (1-1)$$

$$= \frac{1}{20.169} \log \frac{P_{\text{O}_2}^0}{P_{\text{O}_2}}$$

where  $E$  = emf in millivolts

$T$  = Temperature in  $^{\circ}\text{K}$ .

$F$  = Faraday constant

$R$  = Universal gas constant

$P_{O_2}$  is determined from measurement of E and T since  $P_{O_2}^0$  is known.

If the gas contains, besides oxygen and inert gas, any species reactive to oxygen such as  $H_2$  or  $CO$ , then an equilibrium similar to the following prevails, since solid electrolyte cells are operated at high temperatures only



$$\text{and } P_{O_2} = \frac{1}{K_H} \left( \frac{P_{H_2O}}{P_{H_2}} \right)^2, \quad (1-3)$$

where  $K_H$  is the equilibrium constant of reaction (1-2).

Therefore measurement of  $P_{O_2}$  allows determination of  $P_{H_2O}/P_{H_2}$  ratio in a gas since the value of  $K_H$  can be calculated from the known standard free energy of formation of  $H_2O$ .

Similarly if the gas contains  $CO$  and  $CO_2$ ,  $P_{CO_2}/P_{CO}$  ratio can be determined. Knowing the total pressure,  $P_{CO}$  and  $P_{CO_2}$  can be calculated individually.

The above examples illustrate as to how the oxygen sensor may be employed for gas analysis.

Over years many methods are being used for oxygen analysis in gases such as Orest apparatus, spectrometry, gas chromatography etc. But the discovery of the concentration cell using solid electrolyte has led to a very successful breakthrough in oxygen concentration measurement in various phases. The outstanding advantages are:

1. Inf response is specific, rapid and continuous.
2. Inf measurement can be done without disturbing the system.
3. Single sensor can be used over wide ranges of oxygen concent..

and temperature.

4. The cell voltage is amenable to high precision measurement.
5. It can be used for the system not containing oxygen also since it measures oxygenizing potential as such.
6. CSZ is excellent ceramic material and stands high temperatures.

There are some inherent limitations also

- 1) It can not be used below  $500^{\circ}\text{C}$  because of high resistance and irreversibility.
- 2) It has a poor thermal shock resistance.

#### B-1-II Some basic considerations

Since both the electrodes are gases, there is a need to separate them completely. It can be done in two ways as shown in figure 1-1. Generally platinum is used as lead wires. It is suitable because of its low reactivity and high melting point. Its surface quickly attains equilibrium with respect to gaseous phase.  $\text{Rh}$ ,  $\text{Ir}$ ,  $\text{Ru}$  etc can be used but are costlier.

#### B-1-III Leakage of oxygen

One problem with solid electrolyte is the leakage of oxygen from reference to the sample gas side (or vice versa) through pores or due to electronic conduction in solid electrolyte. The latter is the predominant mechanism of leakage (5), and it increases sharply with temperature.

When oxygen concentration in inert gas oxygen mixture is measured, especially at low oxygen concentrations, this leakage of oxygen may lead to considerable error in measurement. So to keep the

error within limit, one has to increase the flow of the gas mixture in order <sup>to</sup> make the influence of leaked oxygen negligible.

If there is a leak of  $4 \times 10^{-5}$  cc/sec. at  $1200^\circ\text{K}$ , with pure oxygen as reference, in order to cut down the error to less than 4% the flow rates of the  $\text{Ar-O}_2$  mixture should be at least 0.1, 10,  $10^3$  cc/sec. for  $P_{\text{O}_2}$  values of  $10^{-2}$ ,  $10^{-4}$  and  $10^{-6}$  atmospheres respectively. This means that reasonably accurate measurement is possible upto  $P_{\text{O}_2} \approx 10^{-4}$  atmospheres only (5).

Instead of inert gas oxygen mixture if  $\text{CO-CO}_2$  or  $\text{H}_2\text{-H}_2\text{O}$  mixture is present, then the buffering capacity of the gas is considerably enhanced. The leaked oxygen reacts with  $\text{H}_2$  or  $\text{CO}$  forming  $\text{H}_2\text{O}$  and  $\text{CO}_2$  respectively. Since the change in the concentration of  $\text{CO}_2$  or  $\text{H}_2\text{O}$  is very small, it does not change the  $\text{CO/CO}_2$  or  $\text{H}_2/\text{H}_2\text{O}$  ratio appreciably so even for very low oxidizing potentials reasonably low flow-rates may be employed.

#### B-1-IV Operating temperature range:

At low temperature, resistivity of the electrolyte is high and irreversibility sets in the electrode reaction. Moreover the contact between the Pt-electrode and the solid electrolyte becomes poor. The minimum operating temperature is held to be  $400^\circ\text{C}$  by various investigators.

At high temperature, leakage rates are highly enhanced, electronic conduction increases and volatilization of platinum as oxide begins. The construction and maintenance of the assembly also becomes difficult. The upper temperature reported so far is  $1100^\circ\text{--}1150^\circ\text{C}$

### B-1- V Measurement of the cell emf:

The emf  $E$  in the equation (1-1) is the open circuit emf in ideal case. So no current should be drawn while measuring the cell emf. Otherwise the reading may be considerably erroneous. So measurement is done with high impedance voltmeter. The minimum input impedance is about one megaohm.

### B-1-VI Industrial applications:

Two approaches are possible regarding the use of oxygen sensor. It may be directly introduced into the reaction tube or furnace and direct measurement be made. Alternatively, it may be kept as separate instrument with its own heating arrangement. Latter is preferable since it increases the life of the sensor because of absence of thermal shocks, mechanical and chemical damage etc. Moreover it increases the accuracy since its design can be made sophisticated.

So far this kind of meter is primarily being put to monitor and control the gas composition than to make accurate measurements. It is being used in combustion control, basic oxygen furnace, annealing of metal products, analysis of flue gases in blast furnace, the generation and control of carburizing atmosphere etc.

Few commercial designs have also come up, some of which are the followings.

#### 1) Westinghouse oxygen analyzer (6)

Some of its applications are:

- a) Measurement of oxygen impurities in high purity gases.
- b) Chemical plants: Inert gas blanketing control Control and measurement of oxygen concentration in feed streams.

c) Food Industry: Inert gas blanket monitoring over vats, processing vessels and for industrial safety.

2) Use of oxygen sensor in combustion control of the furnaces: (7)

It senses the oxygen concentration in the furnace flue gases and provides a corrective signal for furnace combustion control.

3) Pulmonary function oxygen monitor<sup>(8)</sup>.

This is for the medical applications. It provides a direct read out of the oxygen concentration in each inspiration-expiration cycle. The oxygen concentration is accurately recorded ( $\pm 1\%$ ) on a moving strip chart which even depicts a variation caused by the heart beat during expiration. Its typical applications are:

- a) Continuous monitoring of post cardiac surgery patient
- b) respiratory efficiency in the post-operative patient
- c) Study of the cardiovascular system through the effect of exercise upon respiration.

## 2-2 Reduction of Iron Ore by Carbon:

It was recognized even in early days, that kinetically, a solid-solid reaction is expected to be much slower compared to a gas-solid one since solid-solid contact area is much smaller compared to gas-solid contact area and solid-state diffusion is much slower compared to mass transfer in gases.

Several investigators (9,10,11) attempted to measure the rates of direct reduction by continuous evacuation of the chamber in the temperature range of 700-1150°C and pressure range of  $5 \times 10^{-4}$ .

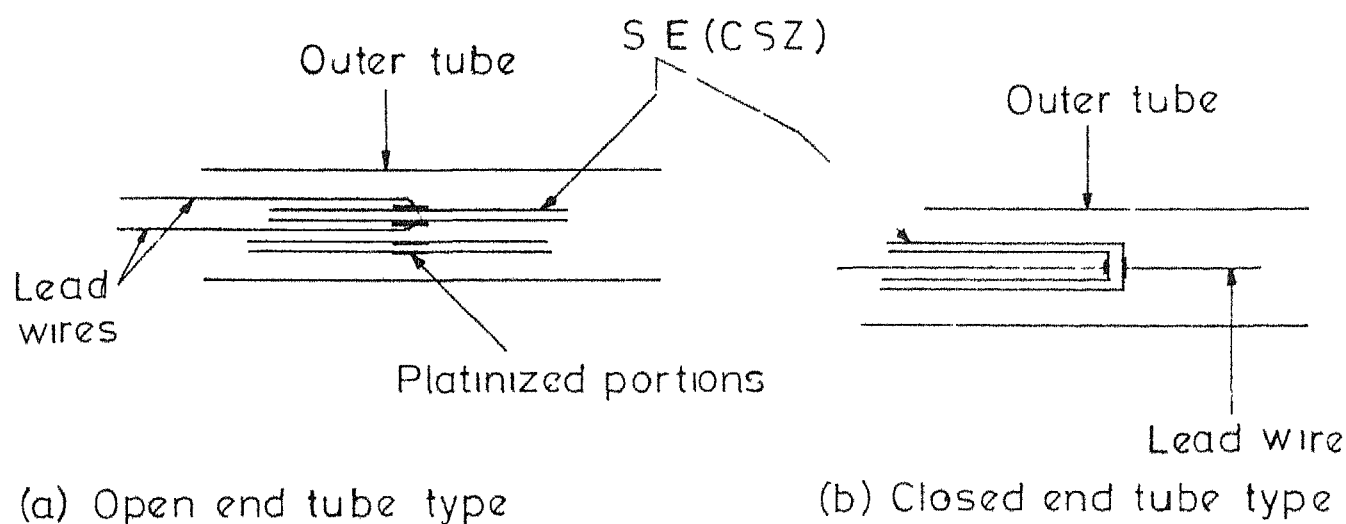


FIG 11

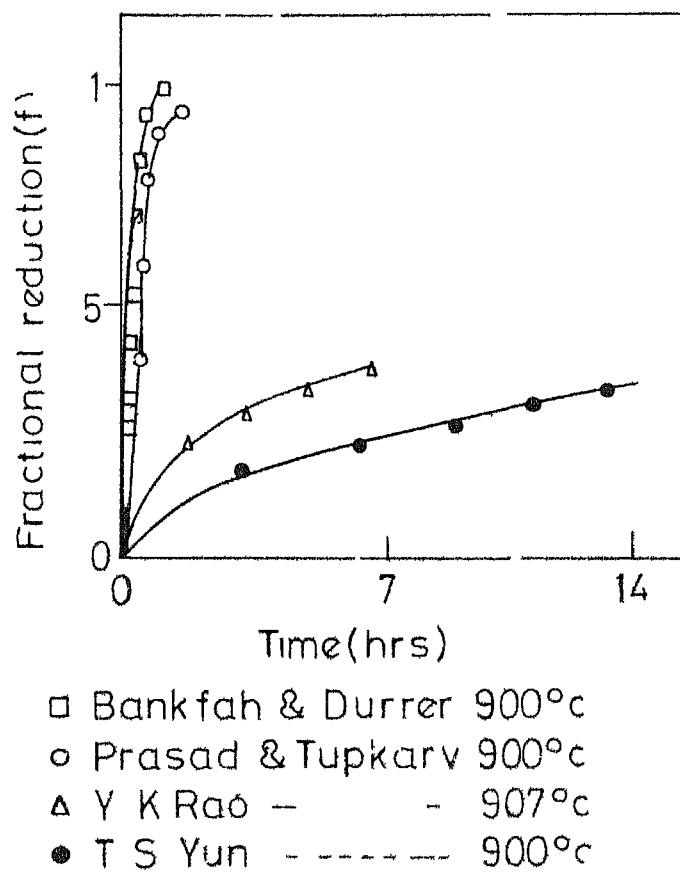


FIG 12

$10 \times 10^{-4}$  torr. They assumed that the gas phases were substantially eliminated by evacuation and hence reaction rates obtained represented those of solid-solid reaction. These results were compared (12) with the experimental data obtained by Y.K. Rao (13), who employed inert gas flushing and that of Baldwin (14), who passed nitrogen over the heated bed of iron oxide and coke.

Results are shown in fig. (1-7). It may be seen that the rates under inert gas flushing were even smaller compared to those obtained under evacuated conditions. These discrepancies were explained by Abrahm and Ghosh (12) in the following way. Flow of gas through a pore is 'Knudsen' when the mean free path is larger than the pore diameter. This condition is very well met in the tiny pores of pellets under the reduced pressure. So although the chamber was evacuated the pressure inside the fine pores of the pellets were likely to be appreciable, because flow of CO and CO<sub>2</sub> from the interior of the pellet to the chamber would require a substantial pressure.

Reduction of iron oxides by carbon occurs in the following two stages.

Reduction of the oxide viz.



and gasification of carbon, viz



First of all the salient kinetic features of these two stages will be presented.



### B-2-1 Kinetics of reduction of iron oxides by carbon monoxide

Some investigators studied the reduction kinetics of  $\text{FeO}$ . Both single-pellet and thermobalance technique (15,16) as well as packed bed systems were employed (17,18, 19). The temperature ranged from  $700^{\circ}\text{C}$  to  $1200^{\circ}\text{C}$  and both  $\text{CO}$  as well as mixtures of  $\text{CO}$  and  $\text{CO}_2$  were employed. The particle size ranged from a fraction of a millimeter to 4 centimeters.

At low flow rates of  $\text{CO}$  or  $\text{CO-CO}_2$  mixtures the rates of reduction were found to depend on the gas flow rate and increased with the increasing flow rate (16,17,18) till there was no more influence. At this stage, reagent starvation as well as mass transfer in the gas phase has significant influence on the reduction rate.

It was observed that the following equation is applicable for the reduction of iron oxides by  $\text{CO}$  (13):

$$1 - (1 - f)^{1/3} = Kt \quad \dots\dots\dots (1-4)$$

where  $f$  = fractional reduction =  $\frac{\% \text{ Reduction}}{100}$

$t$  = time

and  $k$  = constant.

For chemical control,  $K$  of equation (1-4) should be inversely proportional to the diameter of the specimen. This was observed in some cases (20) but Rickensee and Clarke (18) found it to be independent of the size of the specimen. Khalilalla (19) found a marked promoter action of impurity oxides on the reduction of small  $\text{Fe}_2\text{O}_3$  particles (-4 mesh to plus 5 mesh) by  $\text{CO}$ . The extent of reaction rate enhancement was proportional to the ionic radius and

electronic charge of the promoter additive. This pointed out to chemical control.

The values of activation energy were variously found as 8.5 Kcal/mole (15), 13.9 Kcal/mole (18), 33-50 Kcal-mole (19) Khalafalla (19) found an unusually large activation energy (30-50 Kcal/mole) for reduction of coarse and crystalline FeO and  $\text{Fe}_3\text{O}_4$ . He attributed it to a large negative heat of adsorption of CO on the oxide surface.

It is recognized that the reduction process is complex. Such complexity arises from various sources. The product layer is porous and the diffusion process through the pores is influenced by the pore texture, which again depend on a number of factors. In addition, swelling of pellets, cracking during reduction, recrystallization of the reduced iron layer and the presence of unreduced iron oxide islands add to the complexity further.

#### B-2-II) Kinetic aspects of gasification of carbon by $\text{CO}_2$

Cokes, carbon and synthetic graphites are highly porous with pores ranging from about  $10 \text{ \AA}^0$  to several microns in diameter. The kinetic steps involved are gas film diffusion, diffusion through pores and chemical reaction at the gas-solid interface. It has been established that the chemical reaction is exclusively rate controlling below  $1100^\circ\text{C}$ , if the size of the graphite is not too large (diameter less than 1 cm.) such a conclusion has been arrived at from evidences such as high activation energy (60-90 Kcal/mole) and strong influence of solid and gaseous impurities even in trace quantities.

The rate of gasification decreases inermously with increase in percentage of CO in the gas. The rate with pure  $\text{CO}_2$  at 1 atmosphere has been found be to 100 times larger compared to a gas of 90 percent CO- 10 percent  $\text{CO}_2$  at  $900^\circ\text{C}$  (21).

In presence of catalyst the activation energy of the gasification reaction has been found to be as low as 15 Kcal/mole (22).

Walker and co-workers (23) found that the iron is an effective catalyst only when it is present as metallic iron mixed with a little  $\text{FeO}$ . The explanation put forward contends that the oxygen transfer at the graphite surface is enhanced by alternate oxidation of Fe and reduction of  $\text{FeO}$ . The catalytic activity is helped by mobility of oxygen on the metal surface. Ni and Co also exhibit similar catalytic action.

### B-2-III Kinetic aspects of reduction of ironores/oxides by carbon

Amongst the investigations on reaction of iron oxide with carbon, only Otsuka and Kunii (24) , determined the instantaneous rates of oxygen and carbon loss. They used 99 pct. pure  $\text{Fe}_2\text{O}_3$  which was prepared by reacting of iron nitrate at  $800^\circ\text{C}$ . The porous ferric oxide obtained had a specific gravity of 4.7 graphite employed for the reduction was electrode graphite (99.8%) with specific gravity of 2.2 and 31 pct. of pore volume. Standard tests sample of mixture contained 0.8 grams of  $\text{Fe}_2\text{O}_3$  and 0.2 grams of graphite. It was mixed and packed in silica bucket (void fraction 0.8) which was suspended by a platinum chain.

During the reaction, gaseous products were continuously removed by a nitrogen stream. At suitable intervals gas samples were analysed by gas-chromatograph. Overall reaction rate was calculated from the flow rate of the gas produced from the reacting solids.

They found that the reduction occurred in two stages. First stage was the formation of FeO from  $\text{Fe}_2\text{O}_3$  and the second stage was reduction of FeO to metallic Fe. They also observed an increase in the reduction rate after approximately 33 pct reduction which corresponds to complete conversion to FeO. Fig. (1-3) presents typical curves. The first stage had a high activation energy (55-75 Kcal/mole). From this it was concluded that the gasification reaction was rate controlling since the latter also has a high activation energy. There were further proofs for this. The rate increased when the particle size of the graphite was less and it was independent of the particle size of  $\text{Fe}_2\text{O}_3$ .

The increase of rate at the FeO stage could occur only if the carbon solution reaction was accelerated. So it was interpreted that the metallic Fe produced at the surface of the carbon had the catalytic effect on the gasification reaction. This was supported by the low activation energy for the second stage (15-23.5 Kcal/mole.).

The change in the gas composition as reduction proceeded is shown against composition in equilibrium with various oxide mixtures. In fig 1-4 It is evident that the gas was not reducing enough to allow formation of metallic Fe at early stage.

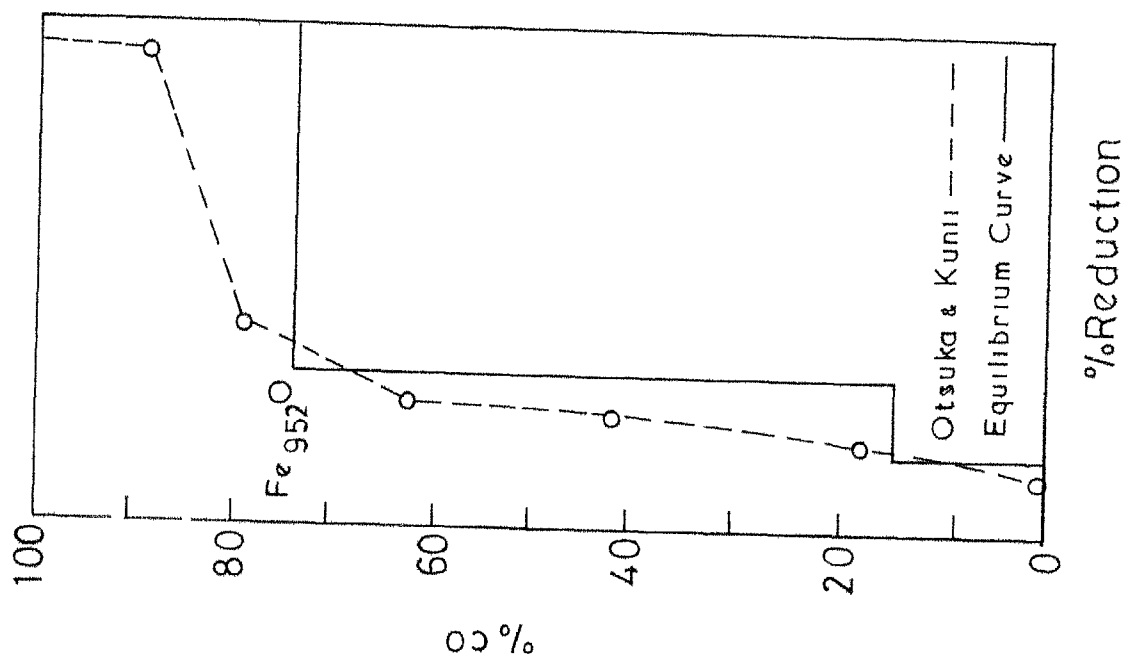


FIG 14

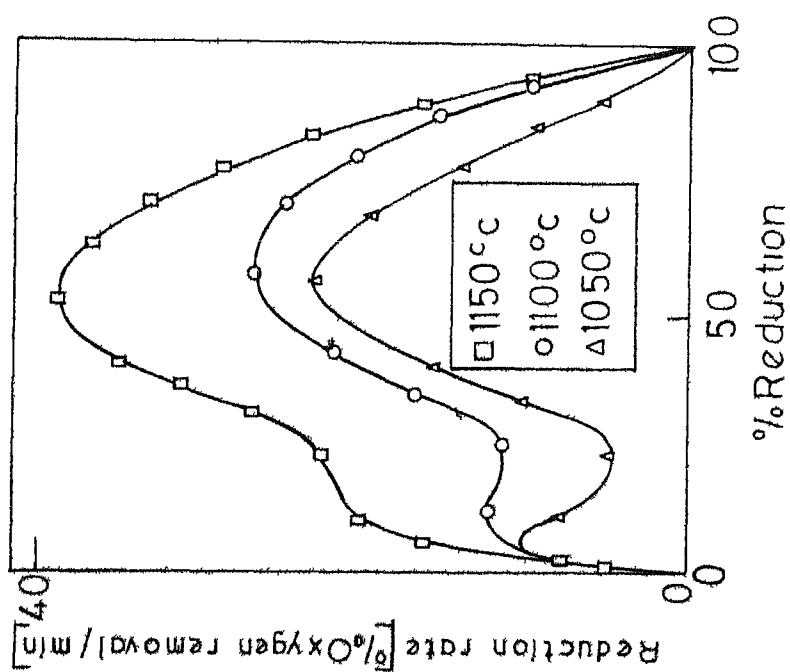


FIG 13

Thus the major conclusions drawn by Otsuka and Kunii were that:

- 1) gasification reaction is the rate controlling and
- 2) reduced iron had catalytic effect on the rate of the reaction.

Besides Otsuka and Kunii, Rao (25) also investigated this reaction and came to the conclusion that gasification reaction is rate controlling.

Since the gasification reaction is chemically controlled, the rate of the reaction is altered by the impurities. This in turn affects the reduction of the iron oxides. Some impurities catalyse the reduction reaction itself.

T.P. Prasad and H.R. Surt (26) have reported that the alkali and alkaline earth salts accelerate the rate of reduction e.g. barium carbonate catalyses the gasification reaction and calcium oxide catalyses the reduction reaction. The accelerating effect of the alkali and the alkaline earth metals was perhaps due to the electronic interaction between the adsorbed oxides of these metals and the oxides being reduced.

While both sodium and potassium carbonates accelerate the reduction,  $\text{Na}_2\text{CO}_3$  is found to be more effective. This was attributed to the formation of surface active compounds and interaction of sodium ions or atoms.

The rate of reduction also depends on the nature of the carbon used for reduction. The reduction rate was higher with charcoal than with graphite. The activity of carbon also reflects in the degree of reduction.

Certain salts were found to act as retarders. Oxides of Mg, Ti, Al and Si retarded the rate of reduction. The decelerating effect of the aluminium oxide and silica was attributed to the formation of aluminate and silicate.

The study by Otsuka and Kunii is the most comprehensive so far. However their conclusions cannot be held to be generally valid for all the types of materials without corroborating evidence. Also they took too little quantity of graphite. So chances are that the graphite got exhausted before the completion of reduction.

### C) Plan of the work:

The following things were decided upon.

- 1) To complete the fabrication of oxygen sensor which was initiated by A.K. Sengupta; alongwith the gas train to purify the gases which will be fed to the oxygen sensor for testing purposes.
- 2) To test its performance using nitrogen oxygen mixtures at various temperatures and concentrations of the oxygen in the mixture.
- 3) To fabricate the reaction cell for the reduction of iron ore from Rajhara mines, Durg, by graphite.
- 4) To arrange for the measurements of instantaneous rates of reduction (rate of oxygen removal from ore) and rate of gasification (rate of carbon loss from graphite). It was planned to accomplish this in the following way.

Precision capillary flow-meters were planned to use in order to know the flow rate of  $\text{CO-CO}_2$  gas mixture generated because

of the reaction of iron Ore and graphite. The oxygen sensor then could measure the oxygen potential of the gas which in turn would give the  $\text{CO}/\text{CO}_2$  ratio as discussed in section (B-1-I). Once the flow rate of gases and the  $\text{CO}/\text{CO}_2$  ratio is known the rates of evaluation of  $\text{CO}$  and  $\text{CO}_2$  individually and hence the instantaneous rates of the carbon and the oxygen removal can be calculated. To obtain the cumulative loss of carbon and oxygen, numerical integration was thought of.

##### 5. Correlation and interpretation of the data obtained.



## CHAPTER II

ApparatusA) Oxygen Sensor:

$ZrO_2 + 10$  mole pct.  $CaO$  in the form of a tube was used as the solid electrolyte with following dimensions (0.95 cm I.D. x 1.27 O.D. x 45.5 cms long). It had closed, flat end. It was supplied by Zirconium Corporation of America. It was checked for leaks under vacuum and was confirmed to be vacuum tight. The closed end was platinised inside as well as outside by applying two successive coatings of the platinum paste and heating it to around  $900^\circ C$ .

The fig 2-1 shows the details of the oxygen sensor and in fig 2-2 combined assembly of the oxygen sensor and the gas-train is shown.

Quartz tube of <sup>15</sup>mm I.D. was used as an enclosure to the S.E. tube with a constriction at the middle, against which the S.E. Tube rested. The other part of the quartz tube was used as preheating chamber. A pt/pt-10% Rh thermocouple was inserted through the preheating chamber, the tip of which was in contact with the S.E. tube. The pt/10% Rh wire of the thermocouple itself was used as one of the lead wires. To improve the contact a small piece of a pt-wire joined to the thermocouple bead was coiled and kept in between the quartz constriction and the S.E. tube which pressed against the former.

A two hole alumina rod (.635 cm. O.D.) was used inside the S.E. tube to hold the pt-10% Rh lead wire and to transport the reference gas into the cell. The tip of this wire was also coiled to

improve the contact. Tygon tubing was used for all the joints.

To further improve the contact between the lead wires and the -S.E. tube, springs were used, which were supported by the hooks on the quartz tube one end and the brass head fitted on the alumina rod at the other.

To eliminate electrical interference from the furnace windings and to avoid the pick up of other stray emfs a grounded inconel tube surrounding the quartz tube, was inserted into the furnace.

The design is similar to that of Ebsell and Flengas (27) with some modifications. Speciality of this design is that the linear velocity of gas at the constriction can be made high.

The furnace employed for the heating of the S.E. cell was a horizontal tube furnace, which could attain a maximum temperature of about  $1100^{\circ}\text{C}$ . Magnesia asbestos powder along with hot face insulating bricks were used for insulation purposes.

Specifications of the furnace were: =

Maximum power rating = 1.5 Kw.



Length of the furnace = 45.7 cm

Outside diameter = 29.2 cm.

Heating element - Kanthal resistance wire

(BSW 16) having a resistivity of  $0.01115 \Omega\text{-cm}$

The furnace was fixed on a slotted angle frame work with castor wheels to make it portable. It could be moved vertically to adjust position. Electrical points were fitted on the trolley itself.

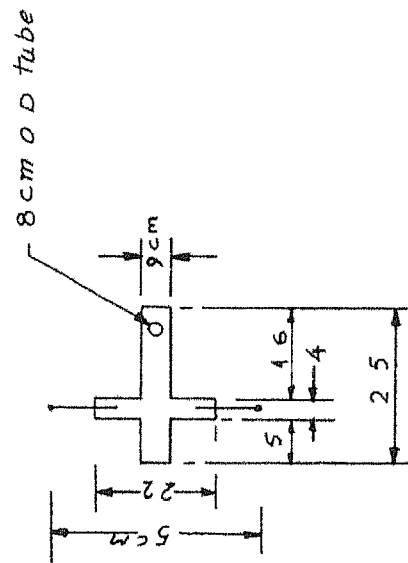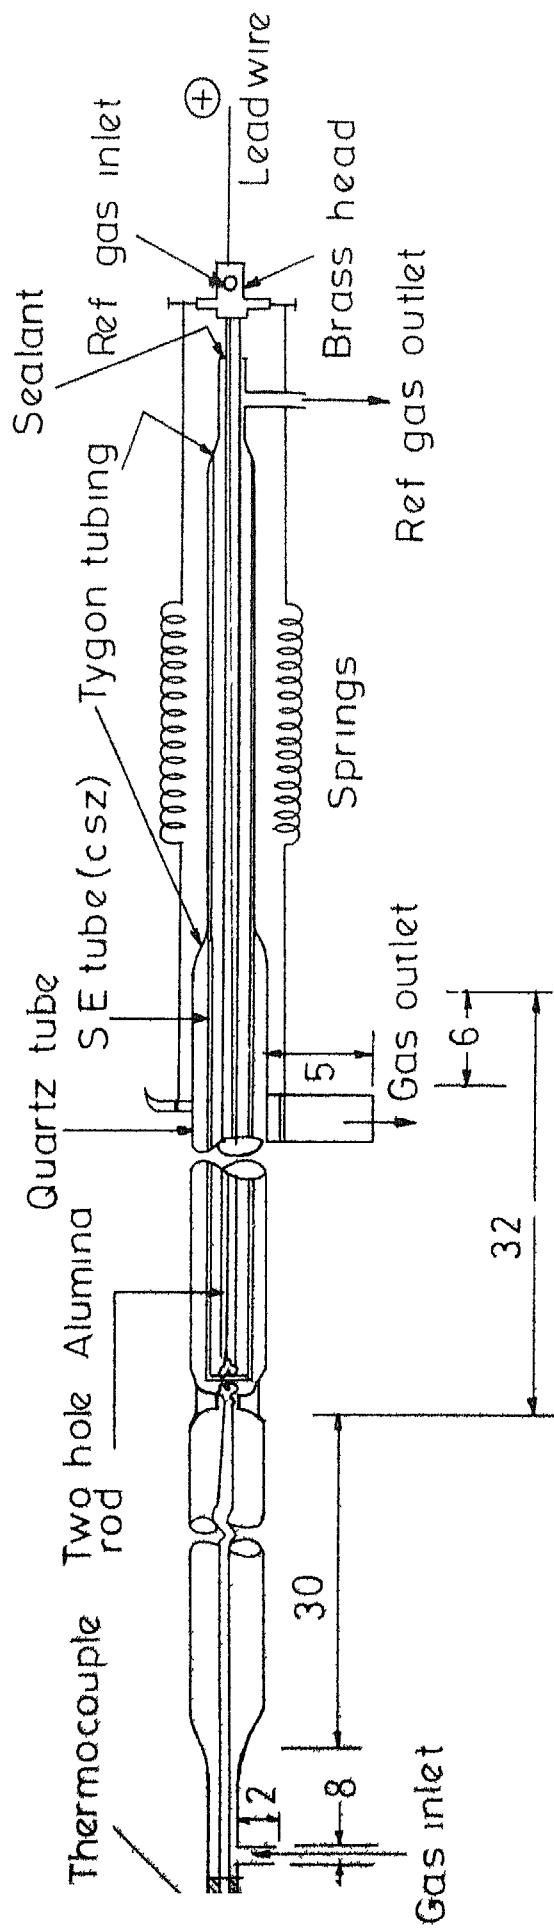

Brass head details

SE Tube (csz) — 0.95 cm ID x 1.27 cm OD  
x 45.5 cm long

dimensions are in cm

FIG 2.1



The lower portion of the trolley was used to keep vari-  
ace, microvoltmeter for emf measurement and also for the gas train  
which was employed to purify the gas before passing it through the  
solid electrolyte assembly.

Cold junction arrangement for the thermocouple was as  
follows. The two ends of the compensating lead wires coming from the  
thermocouple were dipped into two small mercury pools which were kept  
immersed in water in a Dewar flask. A thermometer was used to meas-  
ure the temp of the water.

For measurement of the emf developed, Phillips micro-  
voltmeter with the following specifications was employed. D.C.  
Microvoltmeter pp 9004.

Ranges: 1M  $\Omega$  input impedance - 0.1 mV - 10V

100m  $\Omega$  input impedance - 10mV - 1000V

Temperature was adjusted manually by a valve.

#### B) Ore-Carbon reaction assembly:

B-1) Since the amount of gas generated from the reaction of the  
iron ore and graphite was expected to be small, the minimum possible  
dead volume was aimed at in designing the reaction assembly Fig.  
(2-3) shows this.

An 18 mm I.D. and 22 mm. O.D. translucent quartz tube  
of 30 cm. length (tube 1) was employed as the reaction tube. To this  
a 6 mm I.D. translucent quartz tube was connected at one end.  
Through the latter tube a pt/pt-10%Rh thermocouple was inserted,  
insulated by a 0.15 cm single bore alumina sheath. The 6 mm silica

tube was also employed as an inlet for the purging gas which was passed over the sample during the pre-heating period. Cold junction arrangements were made for the thermocouple as in the previous case.

A 17.3 mm O.D. silica tube (tube 2) had both the ends closed except for a 5 mm I.D. (tube 3) silica tube concentrically joined to it. It had a quartz hook at one end to which a ring made out of kanthal heating element wire was tied. A quartz crucible with the sample (ore and carbon) was fitted in this ring. Thus the 17.3 mm tube helped in inserting the crucible as well as for taking it out. The inner 5 mm dia tube served as the outlet for the gases.

To seal the gap between tube no. 1 and 2, a water cooled brass coupling was employed. The coupling also facilitated the axial movement of tube 2 in tube 1 without letting any air in. A globar furnace was used for heating purpose.

The out let of tube 3 was connected to a capillary with a simple liquid (di butyl phthalate) manometer in between with the help of a 3 mm, I.D. tube. After the capillary again, a 3 mm I.D. tube led was used to lead the gas to the oxygen sensor. Arrangements were made to mix this gas with an inert gas just before it entered the oxygen sensor. Thus the gas mixture generated in the reaction cell flushed out fast through the oxygen sensor so was as to allow in measurement of instantaneous gas composition. This ensured correct  $\text{CO}/\text{CO}_2$  ratio measurement at a particular time to a considerable extent.

The capillary along with the manometer served as a capillary flowmeter. A set of capillaries was used to cover the desired ranges of flow.

The oxygen sensor and the reaction assembly were kept as close as possible in order to minimize the length of the connecting tube so as to cut down the volume.

## CHAPTER III

EXPERIMENTAL PROCEDURES AND MATERIALSA) Procedure for testing of the oxygen sensor:

Inert gas oxygen mixture ( $N_2+O_2$ ) was employed for testing. The gas train employed for purification of these gases consisted of the flow meters, H.T.S. catalyst (obtained from BASF, Germany) furnace for oxygen removal, gas mixers to mix the gases before feeding it to the cell and U-tubes containing anhydrous  $CaCl_2$  and anhydrous to remove the moisture. A bubbler was also used to bypass the gas. The gas mixers consisted of a glass column filled with glass-beads.

Temperature of the solid electrolyte cell, percentage oxygen in the mixture and the flowrate of the gas were the variables. The flowmeters on the  $N_2$  and  $O_2$  lines were calibrated for the respective gases.

The flowmeter reading for both the gases were noted from which the oxygen contents in the mixtures were calculated. The system was allowed to attain steady state after which the steady emf, shown by the microvoltmeter was noted. Temperature was also measured. The microvoltmeter was calibrated with the help of the potentiometer for the necessary correction to the measured emf. When the corrected emf. and the cell temperature were known, corresponding  $PO_2$  could be calculated by using equation (1-1).

The pct. oxygen obtained from flow-meter readings and from the measurement with oxygen sensor were compared in order



to examine the precession of the sensor.

Sometimes air was used as the sample gas. In all the measurements pure  $O_2$  was the reference gas.

Sometimes the sensor chamber was evacuated when switching from one composition to the other, especially at low flow rates of  $N_2$  and  $O_2$ .

Attempts were also made to analyse the gas by gas chromatograph. In these cases the three values of pot. oxygen obtained from 1) gas chromatograph 2) flow-meters and 3) oxygen sensor were compared.

### B) Reduction of iron-ore with graphite:

Iron ore of Rajhara mines (Durg) was chosen for these experiments. It had the following analysis: Fe- 66.1%,  $SiO_2$  1.64%,  $Al_2O_3$  3.8%,  $TiO_2$  absent.  $Fe^{+2}$  ions could not be traced. From this the oxygen content of the ore was estimated to be 28.3 wt. pct, which matched with the oxygen content calculated from weight loss by hydrogen reduction. The ore was found to contain 3.8 pct. moisture. This moisture was chemically held and could be removed only by heating to a higher temperature for at least 5 minutes. The imported low ash electrode graphite supplied by Navinchandra and company was used for the experiments. Total ash content was estimated to be 1.12 per cent. The size of the graphite chosen was -200 mesh. Experiments were conducted at temperatures of approximately  $935^\circ C$ ,  $975^\circ C$ ,  $1015^\circ C$  and  $1050^\circ C$ . Two sizes of the iron ore were chosen: 1) -325 mesh powder 11) 5 mm diameter pellets.

## B-2 Preparation of pellets

The ore was mixed with appropriate amount of water. Green pellets were made by hand-rolling. They were dried in an oven at about  $100^{\circ}\text{C}$  for sometime and then fired to  $900^{\circ}\text{C}$  for about  $2\frac{1}{2}$  hours. The dried iron ore powder, graphite and pellets were stored in a desiccator.

## B-3 Preparation of the sample

For the experiments approximately one gm. iron ore was mixed with 0.4 gm graphite powder and then filled in the quartz crucible with intermittent hand-rolling. The crucible was weighed with and without the sample to know the initial weight of the sample. Then the crucible was fitted in the kanthal ring of tube 2 and inserted halfway in the heated reaction tube for preheating. During preheating an inert gas was made to flow over the sample to remove the moisture etc. Preheating was done for around five minutes. Then the flow of the inert gas was diverted to the oxygen sensor and the sample was pushed to the reaction zone. This time was noted down as the zero time for the reaction. After this at suitable intervals flow-meter readings and S.E. cell emf. were noted down. Emfs were measured by philips V.T.V. M. (Phillips GM 45798, S/N 1098 range-1mV-1000V) The reaction temperature and cell temperature were measured intermittently. V.T.V.M. was calibrated from time to time by potentiometer. The flow of the inert gas purging the oxygen sensor was kept at around 120-130 cc/min. When the reduction was nearly complete the reaction was stopped by taking out the sample. It was then weighed in order to know the weight loss.

In some cases the  $\text{N}_2$  flow caused some static pressure in the gas line from the reaction chamber by which some positive

TABLE 3-1

Calibration of capillaries by argon at 30°C

Capillary No.	$Q V_g \Delta h$ Correlation	$Q V_g \Delta h$ correlation after zero correction
1	$Q = 9.8339 \Delta h + 0.0669$	$Q = 9.83 \Delta h$
2	$Q = 3.7522 \Delta h + 0.1999$	$Q = 3.60 \Delta h$
3	$Q = 0.5807 \Delta h - 0.3974$	$Q = 0.5583 \Delta h$
4	$Q = 0.1542 \Delta h - 0.1106$	$Q = 0.15 \Delta h$

## CHAPTER IV

### RESULTS AND DISCUSSIONS ON PERFORMANCE OF OXYGEN SENSOR

As mentioned in chapter 3, the first part of this investigation consisted of testing the performance of the oxygen sensor. This was done by mixtures of  $O_2$  and  $N_2$ . The oxygen content of this gas mixture was calculated from flow-meter readings and then compared with the oxygen sensor data. This was done at several oxygen contents and temperatures. Table 4-1, and fig. 4-1 present the data. In table 4-1, while calculating the percentage error in the measurement of oxygen concentration by the oxygen sensor, the values of oxygen concentration obtained from the flowmeter readings were assumed to be the correct ones.

These are the 50 pct readings in which the pct. error was below 20 pct. The remaining readings were rejected since the pct errors were more than 20 pct in those cases. Figs 4-1 and 4-2 show the pct error at various gas compositions and temperatures.

The possible sources of errors are:

1) Improper electrode contact

If the lead wires have the improper contact with the platinumized surface of the solid electrolyte tube, the emf measured will be less than the actual one and as the calculated value of pct  $O_2$  will turn out to be higher. In some cases, application of the pressure by hand showed increase in the emf reading as more number of springs were employed to improve the contact.

2) Electronic conduction in the solid electrolyte tube:

If this is present, then also the emf measured will be

Table 4-1

## Performance of oxygen sensor

Sr. No.	O <sub>2</sub>	Flow rates cc/min	Cell Temp °K	Cell Emf mV	pet. O <sub>2</sub> from emf	pet O <sub>2</sub> from flow meters	pet error
1		Air	1098	35.4	21.47	20.9882	+ 2.50
2		air	1086	35.5	21.93	20.9882	+ 4.49
3		air	1115	35.75	22.53	20.9882	+ 7.35
4		air	1121	36.5	22.06	20.9882	+ 5.11
5		air	1177	38.2	22.17	20.9882	+ 5.63
6.		air	1180	37.1	23.24	20.9882	+ 10.73
7.		air	1191	39.7	21.23	20.9882	+ 1.39
8.	24.95	680	1026	72.4	3.61	3.536	+ 7.65
9.	7.93	1136	1050	106.3	0.76	0.6932	+ 9.59
10.	6.5	124	1039	68.0	4.793	4.981	- 3.77
11.	6.5	234	1041	79.1	2.934	2.703	+ 9.55
12.	9.0	142	1041	62.1	6.272	5.96	+ 5.24
13.	8.57	61	1041	50.3	10.61	9.569	+ 10.68
14.	3.679	314.0	1043	96.0	1.395	1.153	+ 20.47
15.	30.57	680.0	1090	71.8	4.701	4.235	+ 11.0

16.	6.1423	99.5	1105	65.71	6.296	6.456	- 2.48
17.	5.071	129.	1114	76.5	4.121	3.782	+ 8.96
18.	5.071	204.	1115	85.3	2.869	2.425	+18.31
19.	5.6423	104.	1152	72.4	5.384	5.157	+ 4.61
20.	5.6423	147.5	1153	79.75	4.053	3.685	+ 9.44
21.	0.857	700.	1177	157.	0.1579	0.1209	+ 14.08
22.	7.86	56.	1179	53.2	12.3	11.93	+ 3.10
23.	6.5	139	1181	76.2	4.998	4.498	+11.12
24.	5.071	311.	1182	126.2	0.9551	0.9776	- 2.22
25.	18.57	390.	1182	75.0	5.259	4.659	+12.66
26.	7.6423	111.0	1184	70.0	6.43	6.442	-0.10
27.	7.6423	274.5	1185	90.7	2.864	2.709	+5.72
28.	6.5	257.5	1186	91.5	2.784	2.4821	+13.07
29.	2.786	279.0	1196	115.4	1.083	0.9887	+9.54
30.	9.0	575	1248	114.5	1.801	1.542	+18.8

2 for air pot.  $O_2$  was calculated assuming 50 pot humidity at 760 mm Hg and 25°C.

Calibration for air at various temperatures

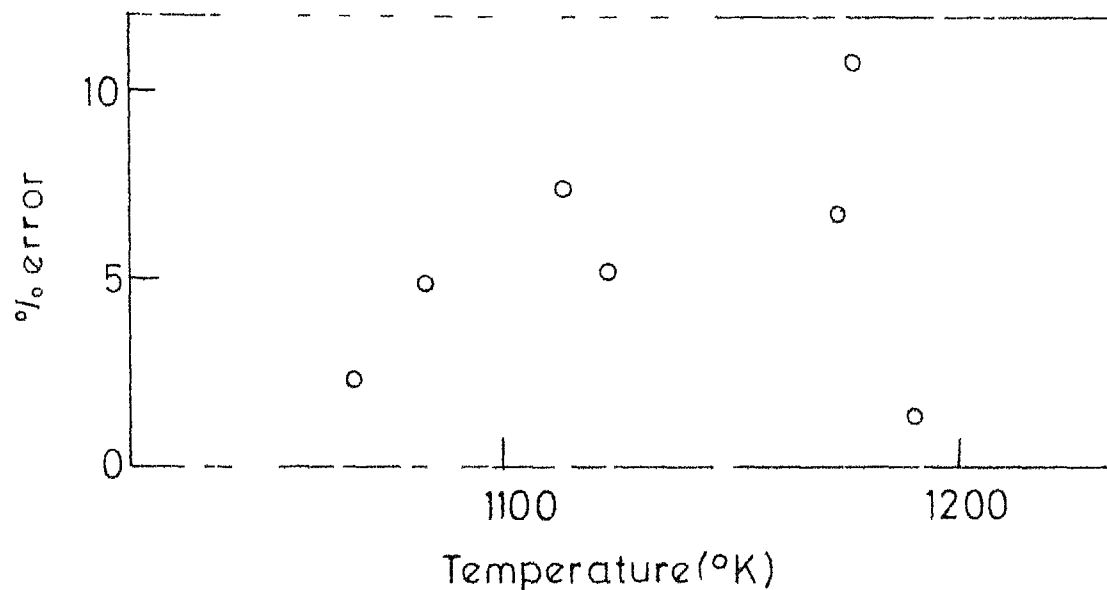


FIG 4-1

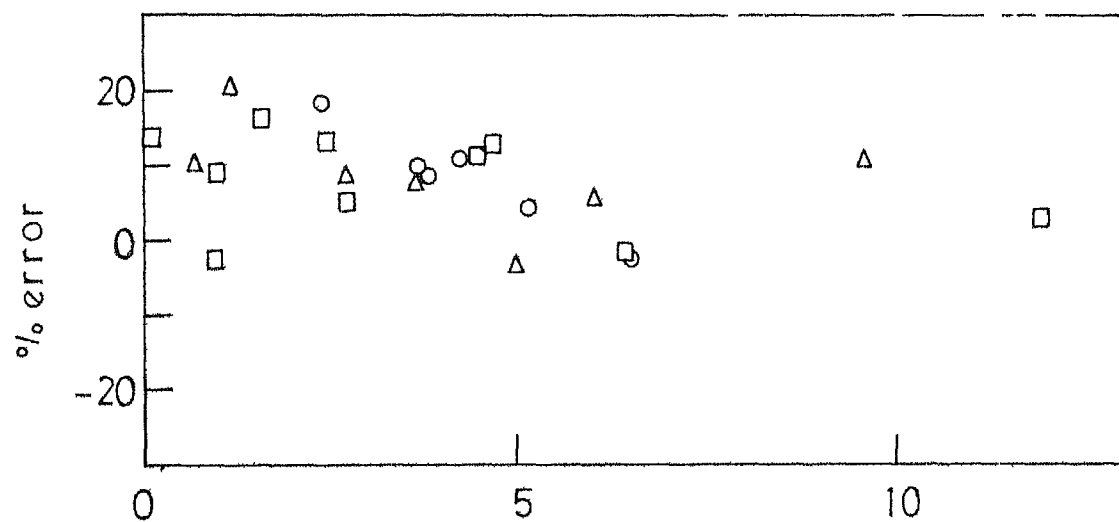


FIG 4-2

%Oxygen in the gas mix

Temperature range °K

△ 1000 1050

○ 1050 1150

□ 1150 on wards

less than the actual. Since the flow rate were quite appreciable this source of error is not expected.

### 3) Scatter in the flowmeter readings:

If the actual amount of gas going into the system is different from that of the value calculated from the flowmeter calibration curve, error will be introduced in the calculation of oxygen concentration. Also the error in the measurement of  $\Delta h$  will introduce error in calculating oxygen concentration. Flowmeter calibrations were repeated in order to minimize this source of error.

### 4) Error in temperature measurement:

The thermocouple used was calibrated with the standard reference thermocouple and was found to be reading the correct temperature. So this error can be assumed to be absent.

### 5) Insufficient pre-heating of the flowing gas:

If the gas velocity is too high, it may not get heated to the cell temperature properly. So the system will not be in equilibrium which is assumed to be so in further calculations. Also it may cool down the outer portion of the solid electrolyte tube, causing the temperature gradient <sup>the</sup> in/ tube itself. So the measurements made will be erroneous. However at low flow rates also errors were present

### 6) Leak in the gas train or apparatus:

If there is any leak after the flow meter in the pure gas line, the actual gas getting mixed will be different from what is being measured which will cause the error in oxygen concentration. Also if the air is leaking in, it will also change the oxygen concentration. To get ~~rid~~ rid of this sort of error attempts were



made to make it leak proof. Still tiny leaks were present which could not be detected. However the leakage rate was hardly 2-3 cc/min and it was outwardly. Therefore it is not expected to affect the readings.

7) Errors in potentiometers and microvoltmeter measurements of emf:

Errors in microvoltmeter readings were minimized by point to point calibration with potentiometer all the time.

To summarize, the improper electrode contact and the scatter of the flow meters especially at low oxygen may be the major sources of error.

Since the oxygen sensor was to be used to measure the  $\text{CO}/\text{CO}_2$  ratio of the gases produced from the reaction of iron ore and graphite, doubt arose about the accuracy of the ratio measurement and of the further calculations of the rate of oxygen and carbon weight loss. For this, sample calculations were made to estimate the pct. error involved in oxygen loss rate ( $\dot{W}_O$ ) as a consequence of error in oxygen sensor measurement. Table 4-2 shows the results of these calculations.

Let the error in  $P_{O_2}$  measurement by oxygen sensor be 30 pct.

$$\text{Since } \frac{P_{\text{CO}_2}}{P_{\text{CO}}} \propto \sqrt{P_{O_2}} \quad \text{error in } \frac{P_{\text{CO}_2}}{P_{\text{CO}}} \quad \text{is 15 pct.}$$

Thus it may be noted that from table 4-2 the errors in the rate of oxygen and carbon loss would be small. Gas composition also would not be in error seriously.

So it was decided to proceed with the study on reduction of iron ore by carbon.

Table 4-2

Estimation of errors in oxygen loss rate

pet. CO <sub>2</sub> in co-CO <sub>2</sub> mixture	Theoretical CO <sub>2</sub> /CO ratio	Measured CO <sub>2</sub> /CO after + 15 pet error	Measured gas comp. pet. CO <sub>2</sub>	Error in %, pet.
10	1/9 = 0.11	0.127	11.2	+ 1.0
50	1/1 = 1	1.15	53.5	+ 2.2
90	9/1 = 9	10.35	91.2	+ 0.7

( %  $\propto$  (Rate of flow of CO + 2 x rate of flow of CO<sub>2</sub>)

## CHAPTER V

### Results of Iron-Ore-Graphite Reactions

Raw data consisted of the reaction temperature, weight of the sample mixture of iron ore and graphite,  $\Delta h$  readings of the capillary flow meter at suitable time intervals and corresponding emf ( $E$ ) of the oxygen sensor. However the values of  $E$  and  $\Delta h$  are hardly useful as such. Hence these were fed to the computer for the following calculations.

#### A) Calculation of CO/CO<sub>2</sub> ratio:

As mentioned before, equilibrium may be assumed to prevail for the following reaction in the oxygen sensor.



$$\therefore 2 \Delta G^\circ_{\text{CO}_2} - 2 \Delta G^\circ_{\text{CO}} = \Delta G^\circ \quad (5.2)$$

For the reaction (5.1) equilibrium constant  $K$  is equal to

$$\left[ \frac{P_{\text{CO}_2}}{P_{\text{CO}}} \right]^2 \times \frac{1}{P_{\text{O}_2}} \quad \dots \quad (5.3)$$

$$G^\circ = -RT \ln K \quad (5.4)$$

where  $T$  = Oxygen sensor temperature,  $^\circ\text{K}$ .

$$\begin{aligned} \therefore G^\circ &= -RT \ln \left[ \left( \frac{P_{\text{CO}_2}}{P_{\text{CO}}} \right)^2 \times \frac{1}{P_{\text{O}_2}} \right] \\ &= -4.606 T (2 \log \frac{P_{\text{CO}_2}}{P_{\text{CO}}} - \log P_{\text{O}_2}) \quad \dots \quad (5.5) \end{aligned}$$

Since the reference gas in the oxygen sensor had approximately 0.96 fraction of oxygen:

$$\log \frac{0.96}{P_{O_2}} = 20.159 - \frac{E}{T} \dots\dots (5.6)$$

(from equation (11))

$$\therefore \Delta G^\circ = 4.606T \left[ -0.02 - 20.159 \frac{E}{T} \right] - 9.212T \log \frac{P_{CO_2}}{P_{CO}} \quad (5-7)$$

Table 5-1 shows the values of  $\Delta G^\circ$  at various temperatures. For the temperatures between 1100°- 1200°K by interpolation:

$$\Delta G^\circ = -85,020 + 41.4 (T - 1200) \text{ Cals/mole} \dots (5.8)$$

Thus once the oxygen sensor temperature and the cell emf (E) are known from equations (5-7) and (5-8), the CO/CO<sub>2</sub> ratio, which is the only unknown, can be determined.

### B) Correction for the capillary constant:

The calibration of the capillary was done with the help of argon gas. But since the gas flowing through the capillary during the reaction was a CO-CO<sub>2</sub> mixture instead of argon, the corresponding viscosity corrections had to be made. Viscosity of the mixture is a function of the individual mole fractions.

$$\mu_{mix} = \sum_{i=1}^2 \frac{x_i \mu_i}{\sum_{j=1}^2 x_j \phi_{ij}} \quad (5-9)$$

$$\text{where } \phi_{ij} = \frac{1}{\sqrt{8}} \left( 1 + \frac{\mu_i}{\mu_j} \right)^{-1/2} \left[ 1 + \left( \frac{\mu_i}{\mu_j} \right)^{1/2} \left( \frac{M_i}{M_j} \right)^{1/4} \right]^2 \quad (5-10)$$

M stands for the molecular weight and

$\mu$  stands for viscosities

on simplification for mixture of CO and CO it gives

TABLE 3-1

Values of  $\Delta G^\circ$  at various temperatures.

Temp. °K	$\Delta G^\circ_{\text{CO}}$ cal/mole	$\Delta G^\circ_{\text{CO}_2}$ cal/mole	$\Delta G^\circ$ cal/mole
1000	- 47,940	- 94,610	- 94,340
1100	- 50,080	- 94,640	- 89,160
1200	- 52,180	- 94,660	- 85,020
1300	- 54,240	- 94,680	- 80,880
1400	- 56,310	- 94,690	- 76,750

$$\mu_{\text{mix}} = \gamma_1 + \gamma_2 \quad \dots \quad (5-11)$$

$$\text{where } \gamma_1 = \frac{1.882 \times 10^{-4} p_{\text{CO}}}{p_{\text{CO}} + 1.5831 p_{\text{CO}_2}} \quad \dots \quad (5-12)$$

$$\text{and } \gamma_2 = \frac{1.495 \times 10^{-4} p_{\text{CO}_2}}{p_{\text{CO}_2} + 0.89974 p_{\text{CO}}} \quad \dots \quad (5-13)$$

**C) Instantaneous rates of generation of CO and CO<sub>2</sub>**

Once the CO/CO<sub>2</sub> ratio is known and the corresponding viscosity correction made, total flow rate 'Q' can be calculated by using the formula:

$$Q = (\text{capillary constant}) \times \frac{\Delta h}{\mu_{\text{mix}}} \quad \dots \quad (5-14)$$

$$\therefore Q_{\text{CO}} = Q \times \text{CO fraction cc/min.} \quad \dots \quad (5-15)$$

$$\text{and } Q_{\text{CO}_2} = Q \times \text{CO}_2 \text{ fraction cc/min.}$$

**D) Calculation of instantaneous rates of loss of carbon and oxygen:**

Since 1 mole of CO corresponds to 1 mole of carbon and oxygen each and one mole of CO<sub>2</sub> corresponds to 1 mole of carbon and 2 moles of oxygen.

$\dot{h}_c$  = Instantaneous rate of wt. loss of carbon

$$= (Q_{\text{CO}} + Q_{\text{CO}_2}) \times 12 / (22400 \times 60) \quad \dots \text{ gms/sec (5-16)}$$

and  $\dot{h}_o$  = Instantaneous rate of wt. loss of oxygen

$$= (Q_{\text{CO}} + 2 \times Q_{\text{CO}_2}) \times 16 / (22400 \times 60) \text{ gms/sec} \quad \dots \quad (5-17)$$

### E) Cumulative loss of 'C' and 'O' and net loss of 'O'

Since the oxygen content of the ore is determined to be 28.3 pct. by weight (30.0 pct. in case of pure  $\text{Fe}_2\text{O}_3$ ), by knowing the amount of ore or pure  $\text{Fe}_2\text{O}_3$  present in the sample, the total weight of the sample fed into the reaction chamber was known.

Trapezoidal rule was employed to numerically integrate instantaneous rates of removal of carbon or oxygen with respect to time. This gave the cumulative wt. loss of carbon and oxygen.

The percentage oxygen removal was obtained from the cumulative oxygen loss ( $W_L$ ) and the total oxygen content at the beginning of the experiment.

The following things were printed in the output of the computer programme:

- 1) Time, min  $t_i$   $t_{i+1}$   $\Delta t = t_{i+1} - t_i$
- 2) Oxygen sensor emf (E), volts
- 3) Instantaneous rate of 'O' wt. loss ( $\dot{W}_O$ ), gms/sec.
- 4) Cumulative oxygen weight loss ( $W_L$ ), gms
- 5) pct. oxygen loss
- 6) Instantaneous rates of 'C' wt. loss ( $\dot{W}_C$ ) gms/sec.

The sum of the cumulative weight losses of oxygen and carbon at the end should match with the experimentally determined total weight loss ( $W_{TG}$ ) if the experimental errors are low.

Table 5-2 shows the experimental conditions of the various experiments performed with different materials.

Appendix- I presents the computer program.

Appendix- II gives a few sample computer printouts.

Table 5-2Experimental conditions of various experiments

Expt. No.	Material	Reaction temp.	S. E. cell Temp. °C	$W_{TE}$ gms	Total time of experi- ment, min	Capill- ary No.
1	Ore powder +graphite	1047	847	0.5445	23	1
2.	----do----	1042	843	0.5113	23	1
3.	----do----	1013	835	0.5180	37	3
4.	----do----	974	821	0.5753	161	2
5 .	----do----	933	825	0.1762	185	4
6.	Ore pellets +graphite	1054	831	0.5193	73	2
7.	----do----	1052	831	0.3485	48	2
8.	----do----	1019	831	0.4035	58	3
9.	----do----	972	818	0.4034	110	2
10.	pure $Fe_2O_3$ +graphite	985	823	0.4289	202	4
11.	----do----	938	838	0.3862	254	4



## CHAPTER VI

### DISCUSSIONS ON RESULTS OF IRON ORE-GRAPHITE REACTION

#### A) Reliability of the results:

As computer print out attached in Appendix II reveal, there are following problems with the results:

- i) CO content of gas is absurdly low (c-0.15)
- ii) Percent reductions are exceeding 100 in many cases. This is not possible.
- iii) In some experiments, notably those with pellets, gas evolution was appreciable even when the pct. reduction was close to 100 percent.

Computer calculations were also carried out assuming that the oxygen partial pressure as monitored by the sensor corresponded to the CO-CO<sub>2</sub>-O<sub>2</sub> equilibrium at the reaction temperature. Some of these calculations are presented in Appendix III. As may be noted, the CO-content of the gas varies between 0-0 pct, which is reasonable.

From this it was concluded that the equilibrium  $\text{CO(g)} + 1/2 \text{O}_2\text{(g)} = \text{CO}_2\text{(g)} \dots\dots (3-1)$  remained essentially 'frozen' even when the gas was being passed through the oxygen sensor. This could be due to comparatively lower temperature in the oxygen sensor and perhaps the slowness of the above reaction.

Therefore further consideration of the data were based upon the latter calculations; since it gave reasonable values of the gas composition. However, it was decided to ignore the gas composition data altogether. Rate of carbon gasification ( $\dot{W}_C$ ) is independent of the gas composition since one mole of CO as well as one mole of CO<sub>2</sub> contains one mole of carbon. So the  $\dot{W}_C$  can be obtained just by knowing the flow

rate of the gas and the gas composition is not required at all. Therefore, rate of gasification was used as a measure of the rate of reduction, for interpretation of data.

Tunkdogan and co-workers (28) have shown that rate of gasification is proportional to the weight of carbon. Therefore fractional rate of carbon gasification was preferred.

$$\text{Fractional } w'_c (h_{e,f}) = \frac{w_s}{\text{Original wt. of carbon in the mixture}} \quad \dots(6.1)$$

The data, as processed by assuming 'frozen'  $\text{CO}/\text{O}_2$  equilibrium were assessed on the basis of the following considerations.

- i) Is the qualitative nature of the variation of gas composition with pct reduction reasonable (as in fig. 1-4) ?
- ii) Is the final pct reduction less than 100 percent ?
- iii) Does the total weight loss as arrived by integration using Trapezoidal rule match with the experimental weight loss measurement ( $W_{TG}$ ) ?
- iv) Was the reaction continuing appreciably even when the pct reduction was more than 100 pct ?.

Table 6-1 summarizes some of these informations.

The experiments where experimental weight loss data were not available were rejected alongwith few others which were grossly irregular. The rest have been included in table 6-1. The experiments have been classified as good, satisfactory and poor.

An experiment considered good had the following characteristics:

- i) The qualitative nature of variation of gas composition with pct. reduction was reasonable.

TABLE 6.1

Calculations on the basis of frozen  $\text{CO-CO}_2\text{-O}_2$  equilibrium

Expt. No.	Materials	Reaction temp. °C.	Pet'0) loss	Total (O+C) loss calculated gms	$\frac{1}{T}$ gms	Remark on data	Basis of correction
1	ore powder + graphite	1047	132.7	0.7714	0.3445	S	100 pet reduction
2.	--do--	1042	165.0	0.4391	0.5113	S	----- do -----
3.	--do----	1013	90.3	0.5180	0.4036	G	----- do -----
4.	-- do----	976	194.5	0.8323	0.5753	S	y = 3/1
5.	-- do----	933	23.2	0.0894	0.1762	F	y = 1/1
6.	Ore pellets + graphite	1024	131.9	0.6294	0.5193	G	100 pet reduction
7.	-- do --	1032	81.1	0.3836	0.3485	G	y = 3/1
8.	-- do----	1019	84.1	0.3687	0.4035	G	y = 2/1
9.	-- do----	972	131.0	0.5264	0.4934	S	y = 2/1
10.	Pure $\text{Fe}_2\text{O}_3$	935	128.5	0.4196	0.4289	G	100 pet reduction
1) d/f	graphite + graphite	938	126.1	0.3779	0.3862	G	----- do -----

\* S - Satisfactory

G - Good

F - Poor.

- ii) Final pct. reduction was not too different from 100 pct.
- iii) Calculated and experimental weight loss matched reasonably.
- iv) The reaction more or less had subsided towards the end.

B0 Corrections to processed data:

The above assessment pointed out that one of the likely sources of error was in the flow rate measurement at high flow-rates. In this case the gas perhaps did not cool to room temperature while passing through the flow meter causing the error in the flow measurement. Also erroneous gas composition would lead to erroneous viscosity values.

Based on all these assessments, it was felt that the final results should be corrected on the basis of the following assumptions.

- i) Experimental total weight loss ( $W_{TG}$ ) is correct.
- ii) A reasonable CO-content of the gas can be guessed.
- iii) Pct reduction cannot exceed 100 pct.

Since causes and natures of errors etc. as assessed were not the same for all experiments, procedures for correction differed from experiment to experiment. However, they fall into the following two broad categories.

- 1) For the experiments where the reaction had subsided, the last pct. reduction should correspond to 100 pct. appreciably. Hence the basis of correction was to assume that the last reading corresponds to 100 pct reduction.

$$W_G (\text{Corrected}) = W_{TG} - 0.283 \times \text{wt. of ore} \dots (6-2)$$

$$\text{or} \quad (0.3) \quad (\text{wt. of pure } \text{Fe}_2\text{O}_3)$$

$$\dot{W}_G (\text{corrected}) = \frac{\dot{W}_G (\text{corrected})}{W_G (\text{as per original calculation})} \times \dot{W}_G (\text{uncorrected}) \quad (6.3)$$

$$\text{Corrected pct reduction} = \frac{\text{pct. reduction}}{\text{final pct reduction(original)}} \times 100$$

2) For experiments where gas evolution continued appreciably at the end, a certain average CO/CO<sub>2</sub> ratio (1/1, 3/2, 2/1 or 3/1), depending on reaction temperature was assumed as  $\gamma$ . Then

$$\text{Since, CO fraction} = \frac{\gamma}{1+\gamma} \quad \dots\dots (6.4 a)$$

$$\text{and CO}_2 \text{ fraction} = \frac{1}{1+\gamma} \quad \dots\dots (6.4. b)$$

$$\begin{aligned} \frac{\text{Moles of O lost}}{\text{Moles of C lost}} &= \frac{1/2 \frac{\gamma}{1+\gamma} + \frac{1}{1+\gamma}}{\frac{\gamma}{1+\gamma} + \frac{1}{1+\gamma}} \\ &= \frac{1/2 \gamma + 1}{\gamma + 1} \end{aligned} \quad (6.5)$$

$$\therefore W_O = \frac{32}{12} \times \frac{\gamma+2}{2(\gamma+1)} W_C \quad \dots\dots (6.6)$$

$$\text{Also } W_{TE} = W_O + W_C \quad \dots\dots (6.7)$$

$$\text{Hence, } W_C (\text{corrected}) = W_{TE} / (1 + \frac{32}{12} \times \frac{\gamma+2}{2(\gamma+1)}) \quad (6.8)$$

$$W_O (\text{corrected}) = W_{TE} - W_C (\text{corrected}) \quad \dots\dots (6.9)$$

$\dot{W}_C$  (corrected) is obtained from equation (6.3)

$$\text{pct. Reduction (corrected)} = \frac{W_O (\text{corrected})}{W_O (\text{Original})} \times \text{pct reduction(original)} \quad (6-10)$$

If pct reduction (corrected)  $\simeq$  100 the final reading was further normalized to 100 pct; otherwise not.

Appendix - IV presents corrected values of fractional carbon loss rate ( $\dot{W}_{C,f}$ ) and pct. reduction. Figures (6-1) to (6-4) show  $\dot{W}_{C,f}$  Vs. pct. reduction curves for various experiments.

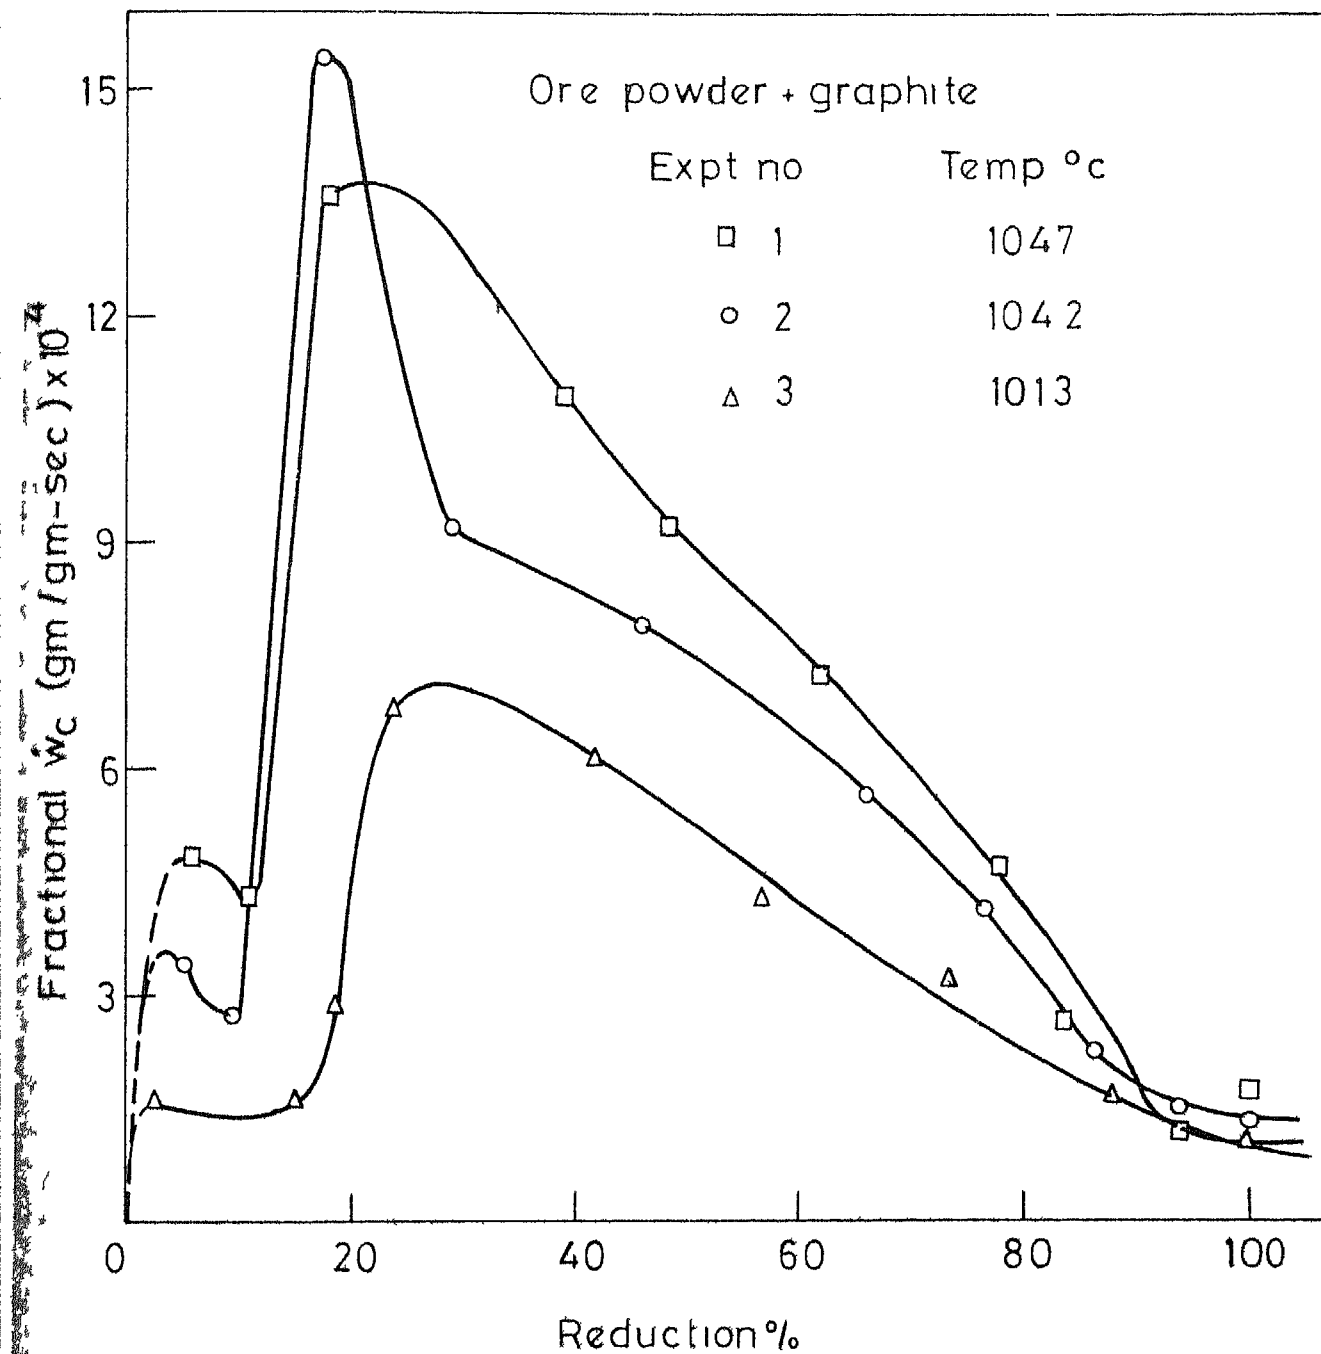


FIG 6-1

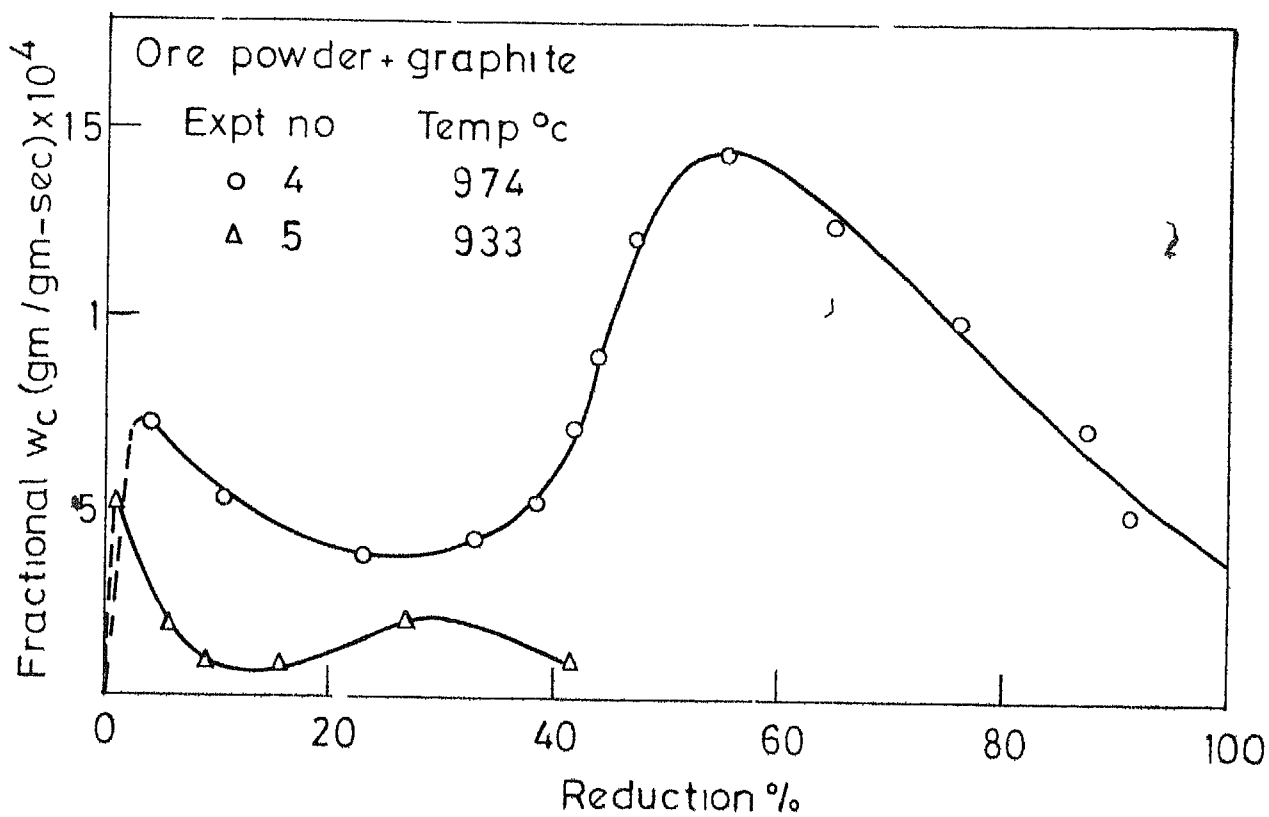


FIG 6-2

1 1 FUR  
CENTRAL LIBRARY  
10 1 1 4 15 1

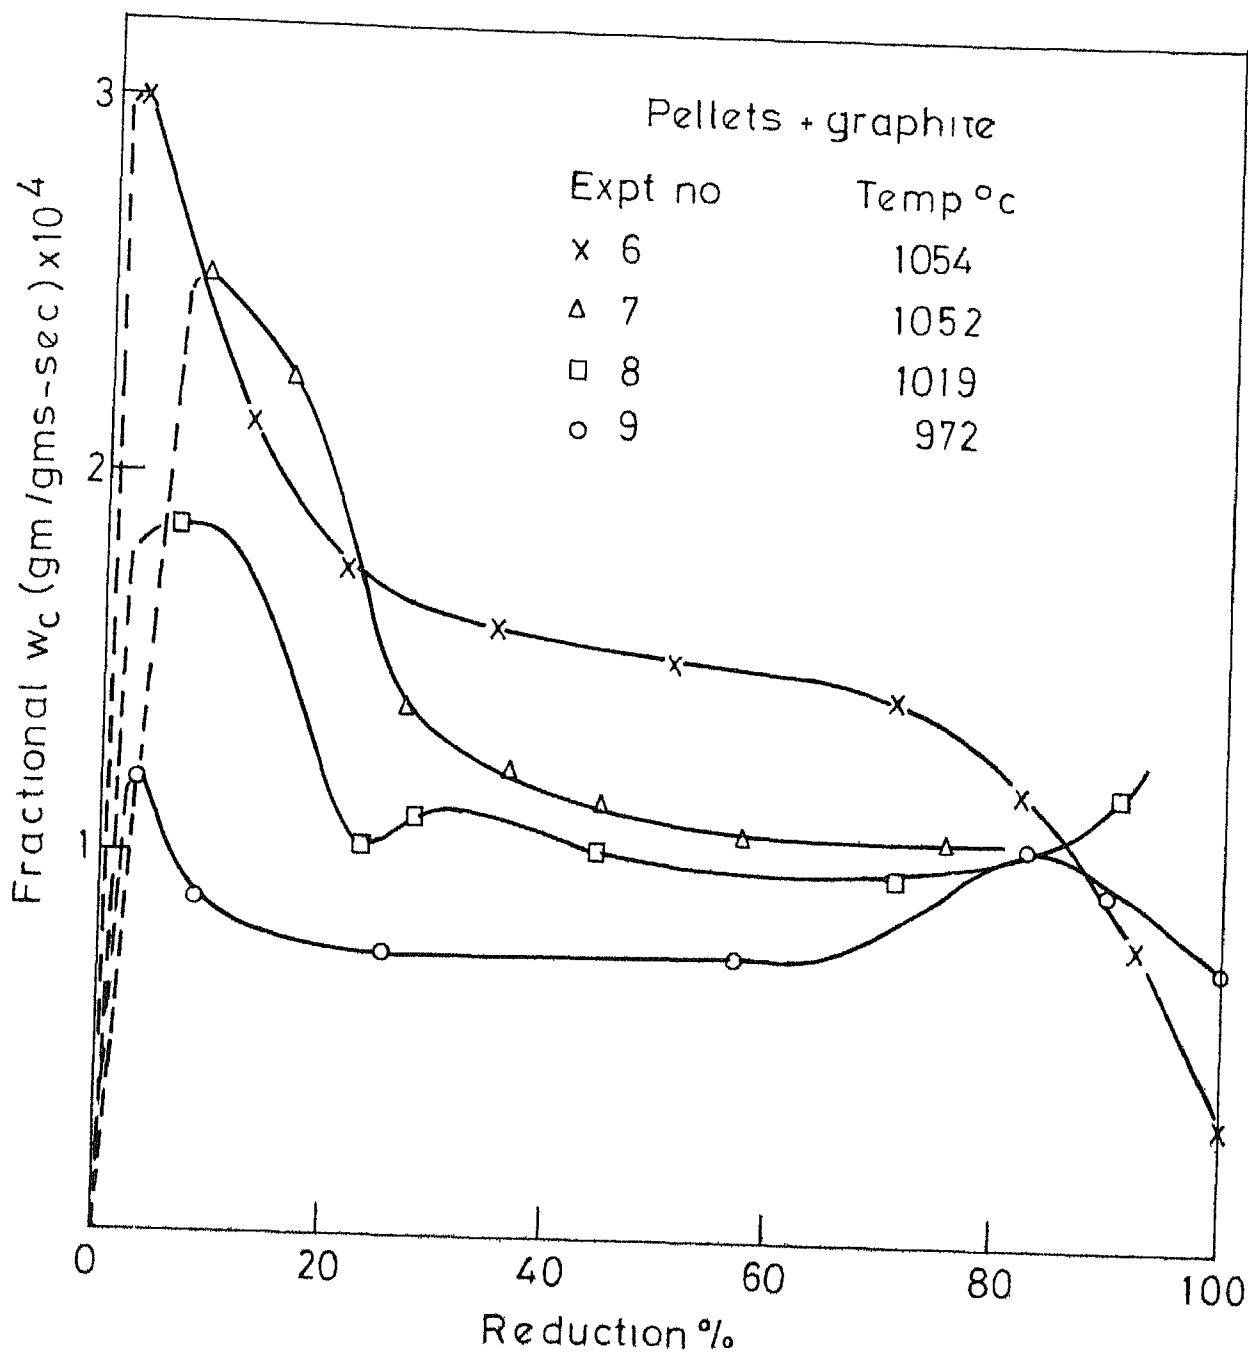


FIG. 6-3




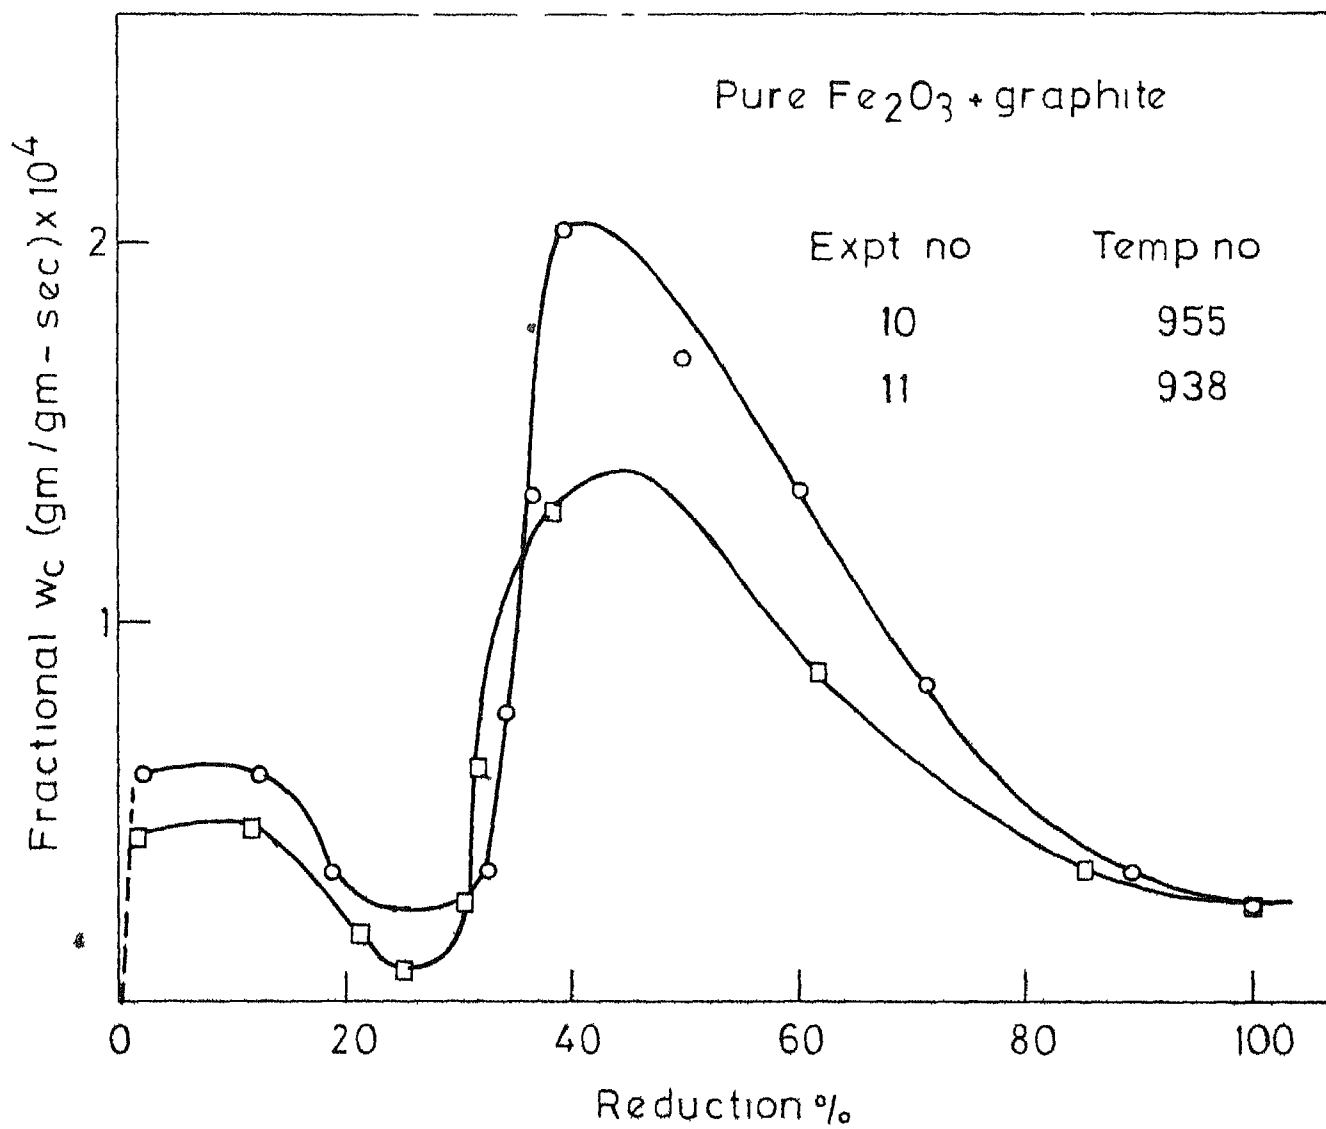


FIG 6-4

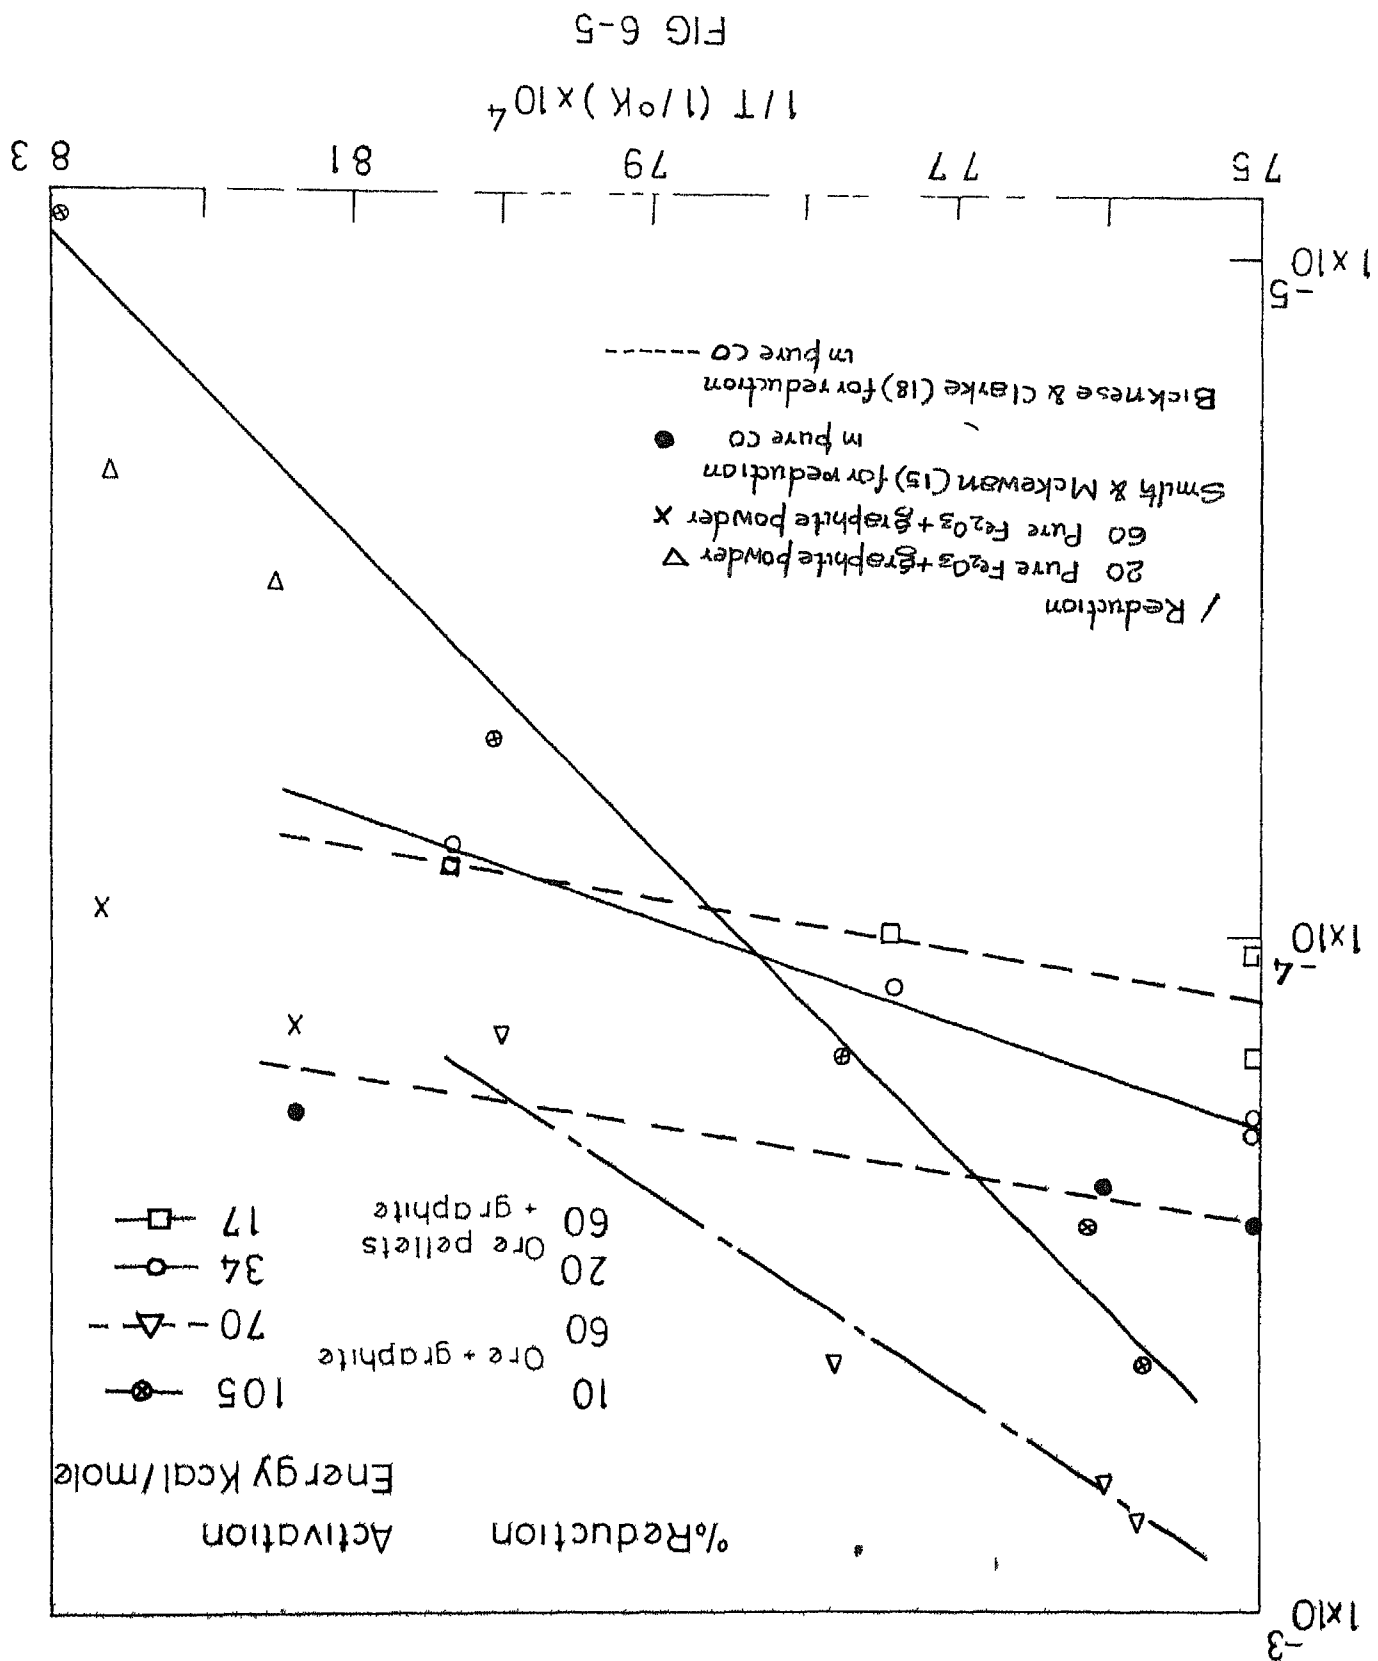

**APPENDIX - I**

**COMPUTER PROGRAMME**

**A P P E N D I X - I I**

**SAMPLE COMPUTER PRINTOUTS ASSUMING**

**CO-CO<sub>2</sub>-O<sub>2</sub> EQUILIBRIUM AT OXYGEN SENS**

**SOR TEMPERATURE.**

EXP RIM NT NO. = 4

REACTION TEMPERATURE = 574 C000

SOLID ELECTROLYTE CELL TEMPERATURE = 82.0 C000

CAPILLARY CONST = C.6608E-C3

WEIGHT OF THE CRF = C.9773

TIME (MINS)	VOLTS	DEL F (GMS)	FRACTION CC	INS.O LOSS (CMS/SEC)	CUM.C LOSS (CMS)	PCT.O LOSS	INS.C LOSS (GMS/SEC)
2.0	0.150	0.00	0.0000	0.1052E-01	0.0139	5.0227	0.3545E-04
4.0	0.150	0.80	0.0000	0.8429E 04	0.0096	0.0000	0.3157E-04
5.0	0.155	0.80	0.0000	0.8429E 04	0.0046	8.909	0.3157E-04
6.0	0.155	0.70	0.0000	0.7367E-04	0.0294	0.62	0.2765E-04
9.0	0.150	0.70	0.0000	0.7367E-04	0.0426	5.06	0.2765E-04
14.0	0.155	0.60	0.0000	0.6314E-01	0.0031	0.0000	0.2368E-04
18.0	0.160	0.60	0.0000	0.6314E-04	0.0783	0.009	0.2368E-04
20.0	0.160	0.50	0.0000	0.5262E-04	0.0852	0.32	0.1973E-04
22.0	0.165	0.50	0.0000	0.5262E-04	0.0916	0.103	0.1973E-04
23.0	0.160	0.50	0.0000	0.5262E-04	0.0947	0.148	0.1973E-04
27.0	0.165	0.50	0.0000	0.5262E-04	0.0073	0.849	0.1973E-04
29.0	0.170	0.50	0.0000	0.5262E-04	0.0037	0.090	0.1973E-04
30.0	0.170	0.50	0.0000	0.5262E-04	0.0068	2.25	0.1973E-04
31.0	0.175	0.60	0.0000	0.6314E 04	0.1203	0.249	0.268E-04
34.0	0.180	0.60	0.0000	0.6314E-04	0.1317	7.507	0.268E-04
35.0	0.170	0.60	0.0000	0.6314E-04	0.354	0.897	0.268E-04
37.0	0.175	0.60	0.0000	0.6314E 04	0.1430	1.72	0.268E-04
38.0	0.180	0.60	0.0000	0.6314E-04	0.468	0.080	0.268E-04
40.0	0.185	0.60	0.0000	0.6314E-04	0.544	0.007	0.268E-04
41.0	0.220	0.70	0.0000	0.7367E 04	0.585	7.007	0.268E-04
42.0	0.810	0.80	0.0082	0.8192E 04	0.1632	8.993	0.3132E-04
43.0	0.850	1.00	0.0049	0.9898E-04	0.0086	0.95	0.3132E-04
44.0	0.860	1.10	0.1029	0.1075E-04	0.1743	63.194	0.4248E-04
45.0	0.870	0.70	0.142	0.154E 0	0.8	65.6108	0.4614E-04
46.0	0.885	0.40	0.1032	0.308E-04	0.1888	58.280	0.5340E-04
47.0	0.895	0.50	0.1543	0.2309E 0	0.969	71.2842	0.5685E-04
48.0	0.900	0.60	0.214	0.1441E-04	0.2054	4.2322	0.6045E-04
49.0	0.900	0.70	0.214	0.4531E-04	0.2142	77.4564	0.6421E-04
50.0	0.900	2.00	0.214	0.1801E 0	0.2242	81.074	0.7554E-04
51.0	0.895	2.10	0.1943	0.1916E-04	0.254	85.1040	0.7959E-04
52.0	0.890	2.30	0.1782	0.2124E-04	0.2475	89.4870	0.8746E-04

53.0	0.895	2.30	0.1943	0.2099E=0-	0.2602	94.0679	0.877E=04
54.0	0.890	2.40	0.182	0.2217E=0-	0.273	98.749	0.926E=04
55.0	0.895	2.40	0.1943	0.2190E=0-	0.286	103.529	0.9096E=04
56.0	0.900	2.40	0.214	0.2162E=0-	0.294	108.2496	0.9065E=04
57.0	0.895	2.30	0.1943	0.2099E=0	0.3122	112.870	0.8717E=04
58.0	0.890	2.20	0.182	0.2052E=0	0.3246	117.357	0.866E=04
60.0	0.885	2.20	0.1832	0.2055E=0	0.349	126.2183	0.894E=04
61.0	0.885	2.10	0.1822	0.1962E=0-	0.356	130.5753	0.800E=04
62.0	0.88	2.00	0.1832	0.1868E=0-	0.3726	134.7296	0.7628E=04
64.0	0.880	1.90	0.192	0.1790E=0	0.3946	142.0713	0.7268E=04
66.0	0.885	1.80	0.1832	0.168E=0	0.425	150.27	0.6866E=04
65.0	0.885	1.70	0.1832	0.1588E=0-	0.4449	160.807	0.6484E=04
72.0	0.885	1.60	0.1832	0.1495E=03	0.4726	170.88	0.6103E=04
74.0	0.885	1.50	0.1832	0.140E=0-	0.4900	177.69	0.572E=04
76.0	0.880	1.40	0.192	0.1322E=0-	0.5063	183.0705	0.5355E=04
78.0	0.880	1.30	0.192	0.1227E=0-	0.526	188.5954	0.4973E=04
80.0	0.880	1.20	0.192	0.1135E=0-	0.5358	197.788	0.4590E=04
81.0	0.880	1.10	0.192	0.1038E=0	0.5423	206.737	0.4208E=04
82.0	0.880	1.00	0.192	0.9439E=04	0.5482	216.38	0.3825E=04
83.0	0.875	1.00	0.163	0.9531E=0	0.5539	220.485	0.3835E=04
84.0	0.875	0.90	0.163	0.8578E=04	0.5594	227.8469	0.3452E=04
85.0	0.870	0.80	0.142	0.7693E=0-	0.5642	239.2901	0.3070E=04
87.0	0.865	0.80	0.1432	0.7755E=04	0.5735	243.1177	0.3083E=04
92.0	0.865	0.70	0.132	0.6787E=04	0.5953	245.6804	0.2598E=04
94.0	0.860	0.70	0.1029	0.6858E=04	0.6035	249.3598	0.2703E=04
101.0	0.860	0.60	0.1029	0.5861E=04	0.6202	251.5408	0.2317E=04
110.0	0.860	0.60	0.1029	0.5861E=04	0.6618	262.574	0.2322E=04
113.0	0.855	0.60	0.0935	0.5901E=04	0.672	263.6192	0.2320E=04
115.0	0.850	0.60	0.049	0.5939E=04	0.6795	264.7248	0.2330E=04
116.0	0.845	0.60	0.0770	0.5973E=04	0.683	268.059	0.1944E=04
118.0	0.840	0.50	0.0698	0.5004E=04	0.6897	270.7752	0.1949E=04
120.0	0.830	0.50	0.072	0.5050E=04	0.6957	271.592	0.1952E=04
130.0	0.825	0.50	0.018	0.5070E=04	0.726	278.1033	0.1954E=04
131.0	0.820	0.50	0.068	0.5088E=04	0.729	279.2253	0.1956E=04
132.0	0.815	0.50	0.023	0.5105E=04	0.7322		0.1957E=04
135.0	0.810	0.50	0.082	0.5120E=04	0.744		0.1959E=04
137.0	0.805	0.50	0.045	0.5135E=04	0.7475		0.1960E=04
138.0	0.800	0.50	0.011	0.5146E=04	0.7506		0.1963E=04
144.0	0.790	0.50	0.0253	0.5167E=04	0.7691		0.1964E=04
145.0	0.785	0.50	0.028	0.5177E=04	0.7723		

147.0	0.780	0.50	0.006	0.5185E-04	0.785	281.4722	0.1905E-04
148.0	0.765	0.50	0.054	0.5205E-04	0.7810	282.6002	0.1907E-04
149.0	0.755	0.50	0.022	0.5215E-04	0.7847	283.7307	0.1968E-04
150.0	0.745	0.50	0.055	0.5225E-04	0.7879	284.8622	0.1969E-04
151.0	0.745	0.50	0.099	0.5225E-04	0.7910	285.9967	0.1969E-04
152.0	0.730	0.50	0.072	0.5235E-04	0.7942	287.1233	0.1970E-04
153.0	0.735	0.50	0.080	0.5235E-04	0.7973	288.2666	0.1970E-04
154.0	0.720	0.50	0.055	0.5240E-04	0.8004	289.4033	0.1971E-04
155.0	0.715	0.50	0.053	0.5242E-04	0.8036	290.5295	0.1971E-04
156.0	0.695	0.50	0.035	0.5249E-04	0.8067	291.6775	0.1972E-04
157.0	0.660	0.50	0.046	0.5256E-04	0.8099	292.8229	0.1973E-04
158.0	0.290	0.50	0.000	0.5262E-04	0.8130	293.9578	0.1973E-04
159.0	0.280	0.50	0.000	0.5262E-04	0.8162	295.0993	0.1973E-04
160.0	0.275	0.50	0.000	0.5262E-04	0.8193	296.2408	0.1973E-04
161.0	0.250	0.50	0.000	0.5262E-04	0.8225	297.3823	0.1973E-04

TOTAL LOSS=	0.8225
TOTAL LOSS=	0.3255

5  
 RATUR = 935.0000  
 YTL C\_LL TEMPERATURE = 826.0000  
 T = .2608E-04  
 HEIGHT OF THE CRF = 0.9900

TIME (MINS)	VOLTS	DEL H (GMS)	CC FRACTION	INS.C LOSS (CMS/SEC)	CUM.C LOSS (CMS)	PCT O LOSS	INS.C LOSS (GMS/SEC)
2.0	0.120	4.50	0.000	0.205E-04	0.004	0.489	0.754E-05
4.0	0.125	4.00	0.000	0.604E-04	0.006	1.476	0.625E-05
5.0	0.125	2.10	0.000	0.288E-04	0.004	1.595	0.4829E-05
7.0	0.125	2.50	0.000	0.1039E-04	0.005	2.090	0.3855E-05
9.0	0.125	2.40	0.000	0.9970E-04	0.007	2.527	0.3759E-05
12.0	0.130	2.20	0.000	0.8724E-04	0.008	3.127	0.3272E-05
13.0	0.130	1.90	0.000	0.7893E-04	0.005	3.660	0.2960E-05
17.0	0.130	1.60	0.000	0.6647E-04	0.004	3.974	0.2493E-05
20.0	0.135	1.50	0.000	0.6231E-04	0.003	4.381	0.2357E-05
22.0	0.140	1.30	0.000	0.5401E-04	0.003	4.635	0.2025E-05
25.0	0.145	0.90	0.000	0.3739E-04	0.003	4.928	0.1402E-05
27.0	0.140	1.00	0.000	0.4154E-04	0.004	5.097	0.1558E-05
30.0	0.150	0.80	0.000	0.3323E-04	0.005	5.380	0.1246E-05
34.0	0.155	0.90	0.000	0.3739E-04	0.005	5.645	0.1402E-05
38.0	0.155	0.80	0.000	0.3323E-04	0.006	5.943	0.1246E-05
41.0	0.155	0.90	0.000	0.3739E-04	0.007	6.169	0.1402E-05
45.0	0.160	1.00	0.000	0.4154E-04	0.008	6.597	0.1558E-05
50.0	0.155	1.00	0.000	0.4154E-04	0.009	6.948	0.1558E-05
52.0	0.160	1.20	0.000	0.4985E-04	0.010	7.444	0.1869E-05
55.0	0.160	1.20	0.000	0.4985E-04	0.012	7.894	0.1869E-05
67.0	0.140	1.20	0.000	0.4985E-04	0.024	8.745	0.1869E-05
70.0	0.140	1.30	0.000	0.5401E-04	0.025	9.079	0.2025E-05
76.0	0.145	1.30	0.000	0.5401E-04	0.027	9.775	0.2025E-05
80.0	0.150	1.40	0.000	0.5816E-04	0.030	10.974	0.2161E-05
92.0	0.145	1.40	0.000	0.5816E-04	0.039	12.095	0.2161E-05
100.0	0.145	1.50	0.000	0.6231E-04	0.057	12.740	0.2357E-05
110.0	0.145	1.50	0.000	0.6231E-04	0.094	14.076	0.2357E-05
115.0	0.155	1.70	0.000	0.7062E-04	0.041	14.781	0.2648E-05
127.0	0.155	1.70	0.000	0.7062E-04	0.046	16.603	0.2648E-05
135.0	0.155	1.50	0.000	0.6231E-04	0.097	17.401	0.2357E-05
145.0	0.155	1.40	0.000	0.5816E-04	0.033	19.050	0.2161E-05



151.0	0.143	1.30	0.0000	0.3401E 02	0.0553	9.7507	0.2025E 02
155.0	0.150	1.20	0.0000	0.4985E 02	0.0566	90.4956	0.1809 -05
165.0	0.143	1.20	0.0000	0.4985E 02	0.0590	2.262	0.1809 -05
172.0	0.150	1.10	0.0000	0.4570E 02	0.0623	2.8770	0.1714E 02
180.0	0.150	1.10	0.0000	0.4570E 02	0.0638	22.7548	0.1714E 02
185.0	0.155	0.90	0.0000	0.3739E 02	0.0650	23.2046	0.1402E 02

TOTAL 0 LGSS= C.0650  
 TOTAL C LOSS= C C244

EXPERIMENT NO. =  
 REACTION TEMPERATURE = 972.0000  
 SOLID ELECTROLYTE CELL TEMPERATURE = 818.5000  
 CAPILLARY CONST = 0.6608E C3  
 WEIGHT OF THE CRF = 1.0025

TIME (MINS)	VOLTS	DEL H (GMS)	CC FRACTION	INS.O LOSS (CMS/SEC)	CUM C LOSS (CMS)	PCT.O LOSS	INS.C LOSS (GMS/SPC)
3.0	0.150	0.80	0.0000	0.849E 0	0.00	50	0.357 -04
4.0	0.150	0.70	0.0000	0.7367E 0	0.040	2303	0.276 -04
5.0	0.145	0.70	0.0000	0.7367E 0	0.0193	6.7853	0.2763 04
6.0	0.145	0.60	0.0000	0.6314E 04	0.0274	9.270	0.268 -04
7.0	0.150	0.60	0.0000	0.6314E 0	0.0274	9.5704	0.268 04
8.0	0.145	0.60	0.0000	0.6314E 04	0.0309	0.9048	0.268 -04
9.0	0.130	0.60	0.0000	0.6314E 04	0.0347	2.242	0.2368 04
10.0	0.120	0.60	0.0000	0.6314E 04	0.0385	3.576	0.2208 04
11.0	0.110	0.60	0.0000	0.6314E 0	0.0422	4.940	0.197 -04
12.0	0.110	0.50	0.0000	0.5262E 0	0.0527	8.5843	0.197 -04
13.0	0.110	0.50	0.0000	0.5262E 0	0.0717	15.265	0.197 -04
14.0	0.110	0.50	0.0000	0.5262E 0	0.0847	9.770	0.197 -04
15.0	0.110	0.50	0.0000	0.5262E 0	0.0906	9.884	0.197 -04
16.0	0.105	0.50	0.0000	0.5262E 0	0.0958	3.05	0.197 -04
17.0	0.105	0.50	0.0000	0.5262E 0	0.100	25.2708	0.197 -04
18.0	0.105	0.50	0.0000	0.5262E 0	0.1064	77.5025	0.197 -04
19.0	0.105	0.50	0.0000	0.5262E 04	0.1222	13.0656	0.197 04
20.0	0.105	0.50	0.0000	0.5262E 0	0.138	54.1950	0.197 04
21.0	0.105	0.50	0.0000	0.5262E 0	0.160	6.4206	0.197 04
22.0	0.105	0.50	0.0000	0.5262E 04	0.1664	18.643	0.197 04
23.0	0.105	0.50	0.0000	0.5262E 0	0.1727	60.8720	0.197 04
24.0	0.105	0.50	0.0000	0.5262E 0	0.1759	11.9848	0.197 04
25.0	0.110	0.50	0.0000	0.5262E 04	0.1885	46.475	0.197 04
26.0	0.110	0.50	0.0000	0.5262E 04	0.1980	69.7756	0.197 04
27.0	0.110	0.50	0.0000	0.5262E 04	0.206	74.2200	0.197 04
28.0	0.110	0.50	0.0000	0.5262E 04	0.210	77.565	0.197 04
29.0	0.110	0.50	0.0000	0.5262E 04	0.2137	78.7800	0.197 04
30.0	0.110	0.50	0.0000	0.5262E 04	0.2150	88.4	0.197 04
31.0	0.110	0.50	0.0000	0.5262E 04	0.2164	92.1476	0.197 04
32.0	0.110	0.50	0.0000	0.5262E 04	0.2179	98.856	0.197 04
33.0	0.110	0.50	0.0000	0.5262E 04	0.2194	104.2904	0.197 04

0.135  
0.140  
0.155  
0.175  
0.400  
0.760  
0.900  
0.810  
0.620  
0.815  
0.825  
0.830  
0.820  
0.805  
0.780  
0.685  
0.185  
0.160  
0.150  
0.145

0.60  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.70  
0.60  
0.60  
0.50  
0.50  
0.50

0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000  
0.0000

0.6214E 00  
0.7307E 00  
0.7567E 00  
0.7307E 00  
0.7367E 00  
0.7296E 00  
0.7209E 00  
0.7174E 00  
0.7262E 00  
0.7155E 00  
0.7048E 00  
0.7078E 00  
0.7130E 00  
0.7192E 00  
0.7262E 00  
0.6302E 00  
0.6314E 00  
0.5262E 00  
0.5262E 00  
0.5262E 00

0.2950  
0.2996  
0.0080  
0.0029  
0.0010  
0.0027  
0.0020  
0.0020  
0.0034  
0.0009  
0.0046  
0.0030  
0.0036  
0.0038  
0.0032  
0.0037  
0.0038  
0.0038  
0.0038  
0.0037

104 6 2  
105 60 78  
08.7 128  
1 0 28 7  
1 8 597  
1 3 5904  
1 4 9244  
1 6 4453  
1 7 9824  
1 9 5174  
1 22 5207  
1 27 00 8  
1 28 5042  
1 0 0 57  
1 1 5472  
2 98 5  
1 4 3 57  
1 5 5398  
1 6 6526  
1 7 654

0.2368E 04  
0.2761E 04  
0.2763E 00  
0.2763E 00  
0.2763E 00  
0.2763E 00  
0.2755E 04  
0.2755E 04  
0.2745E 04  
0.2762E 04  
0.2739E 04  
0.2727E 04  
0.2750E 04  
0.2756E 04  
0.2743E 04  
0.2751E 04  
0.2367E 04  
0.2368E 04  
0.1973E 04  
0.1973E 04  
0.1973E 04

TOTAL 0 LOSS= 0.3909  
TOTAL C LOSS= 0.2470

JCB I OV RFLOW UNDERFLOW DATA CARDS READ LINES PRINTED CARDS PUNCHED  
STATISTICS I CCCCCC CCCCCC 000087 000438 U00000  
COMPUTER CENTRE I I T. KANPUR INDIA \*\*\* COMPUTER INDIA \*\*\* COMPUTER C NTR

1. The first part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

2. The second part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

3. The third part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

4. The fourth part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

5. The fifth part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

6. The sixth part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

7. The seventh part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

8. The eighth part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

9. The ninth part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

10. The tenth part of the document is a list of names and addresses, which appears to be a directory or a list of contacts. The names are written in a cursive script, and the addresses are listed below them.

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100  
101  
102  
103  
104  
105  
106  
107  
108  
109  
110  
111  
112  
113  
114  
115  
116  
117  
118  
119  
120  
121  
122  
123  
124  
125  
126  
127  
128  
129  
130  
131  
132  
133  
134  
135  
136  
137  
138  
139  
140  
141  
142  
143  
144  
145  
146  
147  
148  
149  
150  
151  
152  
153  
154  
155  
156  
157  
158  
159  
160  
161  
162  
163  
164  
165  
166  
167  
168  
169  
170  
171  
172  
173  
174  
175  
176  
177  
178  
179  
180  
181  
182  
183  
184  
185  
186  
187  
188  
189  
190  
191  
192  
193  
194  
195  
196  
197  
198  
199  
200  
201  
202  
203  
204  
205  
206  
207  
208  
209  
210  
211  
212  
213  
214  
215  
216  
217  
218  
219  
220  
221  
222  
223  
224  
225  
226  
227  
228  
229  
230  
231  
232  
233  
234  
235  
236  
237  
238  
239  
240  
241  
242  
243  
244  
245  
246  
247  
248  
249  
250  
251  
252  
253  
254  
255  
256  
257  
258  
259  
260  
261  
262  
263  
264  
265  
266  
267  
268  
269  
270  
271  
272  
273  
274  
275  
276  
277  
278  
279  
280  
281  
282  
283  
284  
285  
286  
287  
288  
289  
290  
291  
292  
293  
294  
295  
296  
297  
298  
299  
300  
301  
302  
303  
304  
305  
306  
307  
308  
309  
310  
311  
312  
313  
314  
315  
316  
317  
318  
319  
320  
321  
322  
323  
324  
325  
326  
327  
328  
329  
330  
331  
332  
333  
334  
335  
336  
337  
338  
339  
340  
341  
342  
343  
344  
345  
346  
347  
348  
349  
350  
351  
352  
353  
354  
355  
356  
357  
358  
359  
360  
361  
362  
363  
364  
365  
366  
367  
368  
369  
370  
371  
372  
373  
374  
375  
376  
377  
378  
379  
380  
381  
382  
383  
384  
385  
386  
387  
388  
389  
390  
391  
392  
393  
394  
395  
396  
397  
398  
399  
400  
401  
402  
403  
404  
405  
406  
407  
408  
409  
410  
411  
412  
413  
414  
415  
416  
417  
418  
419  
420  
421  
422  
423  
424  
425  
426  
427  
428  
429  
430  
431  
432  
433  
434  
435  
436  
437  
438  
439  
440  
441  
442  
443  
444  
445  
446  
447  
448  
449  
450  
451  
452  
453  
454  
455  
456  
457  
458  
459  
460  
461  
462  
463  
464  
465  
466  
467  
468  
469  
470  
471  
472  
473  
474  
475  
476  
477  
478  
479  
480  
481  
482  
483  
484  
485  
486  
487  
488  
489  
490  
491  
492  
493  
494  
495  
496  
497  
498  
499  
500  
501  
502  
503  
504  
505  
506  
507  
508  
509  
510  
511  
512  
513  
514  
515  
516  
517  
518  
519  
520  
521  
522  
523  
524  
525  
526  
527  
528  
529  
530  
531  
532  
533  
534  
535  
536  
537  
538  
539  
540  
541  
542  
543  
544  
545  
546  
547  
548  
549  
550  
551  
552  
553  
554  
555  
556  
557  
558  
559  
560  
561  
562  
563  
564  
565  
566  
567  
568  
569  
570  
571  
572  
573  
574  
575  
576  
577  
578  
579  
580  
581  
582  
583  
584  
585  
586  
587  
588  
589  
590  
591  
592  
593  
594  
595  
596  
597  
598  
599  
600  
601  
602  
603  
604  
605  
606  
607  
608  
609  
610  
611  
612  
613  
614  
615  
616  
617  
618  
619  
620  
621  
622  
623  
624  
625  
626  
627  
628  
629  
630  
631  
632  
633  
634  
635  
636  
637  
638  
639  
640  
641  
642  
643  
644  
645  
646  
647  
648  
649  
650  
651  
652  
653  
654  
655  
656  
657  
658  
659  
660  
661  
662  
663  
664  
665  
666  
667  
668  
669  
670  
671  
672  
673  
674  
675  
676  
677  
678  
679  
680  
681  
682  
683  
684  
685  
686  
687  
688  
689  
690  
691  
692  
693  
694  
695  
696  
697  
698  
699  
700  
701  
702  
703  
704  
705  
706  
707  
708  
709  
710  
711  
712  
713  
714  
715  
716  
717  
718  
719  
720  
721  
722  
723  
724  
725  
726  
727  
728  
729  
730  
731  
732  
733  
734  
735  
736  
737  
738  
739  
740  
741  
742  
743  
744  
745  
746  
747  
748  
749  
750  
751  
752  
753  
754  
755  
756  
757  
758  
759  
760  
761  
762  
763  
764  
765  
766  
767  
768  
769  
770  
771  
772  
773  
774  
775  
776  
777  
778  
779  
780  
781  
782  
783  
784  
785  
786  
787  
788  
789  
790  
791  
792  
793  
794  
795  
796  
797  
798  
799  
800  
801  
802  
803  
804  
805  
806  
807  
808  
809  
810  
811  
812  
813  
814  
815  
816  
817  
818  
819  
820  
821  
822  
823  
824  
825  
826  
827  
828  
829  
830  
831  
832  
833  
834  
835  
836  
837  
838  
839  
840  
84

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100

1. The first part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

2. The second part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

3. The third part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

4. The fourth part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

5. The fifth part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

6. The sixth part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

7. The seventh part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

8. The eighth part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

9. The ninth part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.

10. The tenth part of the document is a list of names and dates, which appears to be a roster or a list of participants. The names are written in a cursive script, and the dates are written in a more formal, printed style. The list is organized into columns, with names in the first column and dates in the second column.



### APPENDIX - III

SAMPLE COMPUTER PRINTOUTS ASSUMING  
 $\text{CO}-\text{CO}_2-\text{C}_2$  EQUILIBRIUM TO BE "FROZEN"  
AT REACTION TEMPERATURE.













1

2

3

4  
5  
6  
7  
8

9

10  
11  
12  
13  
14  
15

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100

(

,

-

1

2

3

1

,

(

1

)

,

1

1/2

1

1

2

2

2 2

1

2

1

\*

1

1

1

1

2

2

1

1

1

1

\*

1







103  
F-01  
SOL  
C-PI-11  
4-20-1

121  
(121)  
121-2

121-2

121-2

121-2

121-2

121-2

121-2

121-2

121-2

121-2

[illegible][illegible]

11  
 12  
 13  
 14  
 15  
 16  
 17  
 18  
 19  
 20  
 21  
 22  
 23  
 24  
 25  
 26  
 27  
 28  
 29  
 30  
 31  
 32  
 33  
 34  
 35  
 36  
 37  
 38  
 39  
 40  
 41  
 42  
 43  
 44  
 45  
 46  
 47  
 48  
 49  
 50  
 51  
 52  
 53  
 54  
 55  
 56  
 57  
 58  
 59  
 60  
 61  
 62  
 63  
 64  
 65  
 66  
 67  
 68  
 69  
 70  
 71  
 72  
 73  
 74  
 75  
 76  
 77  
 78  
 79  
 80  
 81  
 82  
 83  
 84  
 85  
 86  
 87  
 88  
 89  
 90  
 91  
 92  
 93  
 94  
 95  
 96  
 97  
 98  
 99  
 100  
 101  
 102  
 103  
 104  
 105  
 106  
 107  
 108  
 109  
 110  
 111  
 112  
 113  
 114  
 115  
 116  
 117  
 118  
 119  
 120  
 121  
 122  
 123  
 124  
 125  
 126  
 127  
 128  
 129  
 130  
 131  
 132  
 133  
 134  
 135  
 136  
 137  
 138  
 139  
 140  
 141  
 142  
 143  
 144  
 145  
 146  
 147  
 148  
 149  
 150  
 151  
 152  
 153  
 154  
 155  
 156  
 157  
 158  
 159  
 160  
 161  
 162  
 163  
 164  
 165  
 166  
 167  
 168  
 169  
 170  
 171  
 172  
 173  
 174  
 175  
 176  
 177  
 178  
 179  
 180  
 181  
 182  
 183  
 184  
 185  
 186  
 187  
 188  
 189  
 190  
 191  
 192  
 193  
 194  
 195  
 196  
 197  
 198  
 199  
 200  
 201  
 202  
 203  
 204  
 205  
 206  
 207  
 208  
 209  
 210  
 211  
 212  
 213  
 214  
 215  
 216  
 217  
 218  
 219  
 220  
 221  
 222  
 223  
 224  
 225  
 226  
 227  
 228  
 229  
 230  
 231  
 232  
 233  
 234  
 235  
 236  
 237  
 238  
 239  
 240  
 241  
 242  
 243  
 244  
 245  
 246  
 247  
 248  
 249  
 250  
 251  
 252  
 253  
 254  
 255  
 256  
 257  
 258  
 259  
 260  
 261  
 262  
 263  
 264  
 265  
 266  
 267  
 268  
 269  
 270  
 271  
 272  
 273  
 274  
 275  
 276  
 277  
 278  
 279  
 280  
 281  
 282  
 283  
 284  
 285  
 286  
 287  
 288  
 289  
 290  
 291  
 292  
 293  
 294  
 295  
 296  
 297  
 298  
 299  
 300  
 301  
 302  
 303  
 304  
 305  
 306  
 307  
 308  
 309  
 310  
 311  
 312  
 313  
 314  
 315  
 316  
 317  
 318  
 319  
 320  
 321  
 322  
 323  
 324  
 325  
 326  
 327  
 328  
 329  
 330  
 331  
 332  
 333  
 334  
 335  
 336  
 337  
 338  
 339  
 340  
 341  
 342  
 343  
 344  
 345  
 346  
 347  
 348  
 349  
 350  
 351  
 352  
 353  
 354  
 355  
 356  
 357  
 358  
 359  
 360  
 361  
 362  
 363  
 364  
 365  
 366  
 367  
 368  
 369  
 370  
 371  
 372  
 373  
 374  
 375  
 376  
 377  
 378  
 379  
 380  
 381  
 382  
 383  
 384  
 385  
 386  
 387  
 388  
 389  
 390  
 391  
 392  
 393  
 394  
 395  
 396  
 397  
 398  
 399  
 400  
 401  
 402  
 403  
 404  
 405  
 406  
 407  
 408  
 409  
 410  
 411  
 412  
 413  
 414  
 415  
 416  
 417  
 418  
 419  
 420  
 421  
 422  
 423  
 424  
 425  
 426  
 427  
 428  
 429  
 430  
 431  
 432  
 433  
 434  
 435  
 436  
 437  
 438  
 439  
 440  
 441  
 442  
 443  
 444  
 445  
 446  
 447  
 448  
 449  
 450  
 451  
 452  
 453  
 454  
 455  
 456  
 457  
 458  
 459  
 460  
 461  
 462  
 463  
 464  
 465  
 466  
 467  
 468  
 469  
 470  
 471  
 472  
 473  
 474  
 475  
 476  
 477  
 478  
 479  
 480  
 481  
 482  
 483  
 484  
 485  
 486  
 487  
 488  
 489  
 490  
 491  
 492  
 493  
 494  
 495  
 496  
 497  
 498  
 499  
 500  
 501  
 502  
 503  
 504  
 505  
 506  
 507  
 508  
 509  
 510  
 511  
 512  
 513  
 514  
 515  
 516  
 517  
 518  
 519  
 520  
 521  
 522  
 523  
 524  
 525  
 526  
 527  
 528  
 529  
 530  
 531  
 532  
 533

**Figure 6**

[illegible]

[illegible]

# APPENDIX -IV

## Tables of the results of the experiments

### Experiment No. 1

Iron ore powder + graphite

Reaction temp. = 1047°C

Time min	Fe reduction	$\frac{w_c}{w_o}$ if gms/gms-sec $\times 10^4$
2.0	5.00	3.4896
3.0	9.44	2.7509
4.0	17.84	15.4356
5.0	29.03	9.1696
7.0	46.32	7.9213
10.0	66.50	5.6546
12.0	76.60	4.1263
15.0	86.40	2.2413
19.0	93.80	1.5283
23.0	100.00	1.3500

Experiment No. 2

Iron ore powder + graphite

Reaction temperature = 1042° C.

Time min	per cent reduction	$\frac{V_{g,f}}{V_{g,i}}$ gas/gas- = 10 <sup>-4</sup>
2.0	5.55	4.6143
3.0	10.82	4.3022
4.0	18.14	13.5211
6.0	39.12	10.9347
7.0	47.95	9.1677
9.0	62.12	7.1703
12.0	77.68	4.6863
15.0	86.73	2.6689
19.0	93.89	1.7157
23.0	100.00	1.7670

Experiment No. 3

Iron ore powder + graphite

Reaction temperature = 1013°C

Time min	Pct reduction	$v_{c,f}$ gms/gms-sec $\times 10^4$
2.0	2.62	1.6023
7.0	15.06	1.6023
8.0	18.52	2.8009
9.0	23.69	6.8130
12.0	40.17	6.0813
16.0	57.62	4.2140
20.0	70.36	3.2046
28.0	87.64	1.6654
37.0	100.00	1.0598



Experiment No. 4

Iron ore powders graphite

Reaction temperature = 974°C

Time min	per cent reduction	$\frac{w_{\text{Fe}}}{w_{\text{Fe}} + w_{\text{C}}} \times 10^4$
3.0	3.36	0.7169
9.0	10.31	0.5192
23.0	22.91	0.3708
35.0	32.77	0.4203
41.0	38.34	0.5192
45.0	41.7	0.7169
47.0	43.7	0.9147
50.0	47.2	1.2114
55.0	55.2	1.4586
61.0	64.8	1.2608
69.0	75.5	1.0136
80.0	87.2	0.7169
85.0	90.8	0.4944

Experiment No. 5

Iron ore powder + graphite

Reaction temp. = 933°C

Time min	Pct reduction	$w_{e,f}$ gms/gms-sec $\times 10^4$
2.0	0.88	0.4930
12.0	5.66	0.1980
17.0	7.17	0.0990
67.0	15.8	0.0990
115.0	26.7	0.1980
185.0	41.9	0.0990

Experiment No. 6

Iron ore pellets + graphite

Reaction temp = 1054°C

Time min	Pct reduction	$\frac{w_{e,f}}{gms/gms-sec}$ $\times 10^4$
2.0	2.51	2.9982
5.0	12.30	2.1453
9.0	21.15	1.7576
16.0	34.17	1.6283
27.0	51.08	1.5249
37.0	65.30	1.5249
41.0	70.72	1.4474
50.0	81.80	1.1889
62.0	92.33	0.8012
73.0	100.00	0.3102

Experiment No. 7

Iron ore pellets + graphite

Reaction temp. = 1052°C

Time min	wt reduction	$\frac{w}{t}$ gms/gms-sec $\times 10^4$
3.0	8.54	2.9197
5.0	15.10	2.2572
9.0	25.70	1.3911
15.0	35.10	1.2335
21.0	44.40	1.1549
31.0	57.5	1.0761
45.0	75.3	1.0761

Experiment No. 8

Iron ore pellets + graphite

Reaction temp. = 1019°C

Time min	pct reduction	$w_{e,f}$ gms/gms-sec $\times 10^4$
2.0	3.73	1.8583
3.0	6.70	1.8844
9.0	23.00	1.0325
15.0	27.60	1.1100
34.0	44.30	1.0325
45.0	70.70	1.0325
58.0	90.50	1.2132

Experiment No. 9

Iron ore pellets + graphiter

Reaction temp. = 972°C

Time min	per cent reduction	$\frac{w}{t}$ gms./gms. sec $\times 10^4$
3.0	2.72	1.1945
8.0	8.32	0.8829
27.0	25.2	0.7531
64.0	56.7	0.7531
90.0	83.0	1.0647
97.0	90.0	0.9348
110.0	100.0	0.7531

Experiment No. 10

Pure  $\text{Fe}_2\text{O}_3$  + graphite Reaction temp. =  $955^\circ\text{C}$

Time min	per cent reduction	wt $\text{W}_{\text{C},f}$ gms/gms. $\text{Fe}_2\text{O}_3$ $\times 10^4$
4.0	2.04	0.5930
18.0	12.35	0.5930
31.0	18.36	0.3385
79.0	32.27	0.3385
82.0	34.00	0.7538
84.0	35.13	1.3568
86.0	38.93	2.0359
94.0	49.68	1.6985
104.0	60.15	1.3568
119.0	71.48	0.8475
166.0	89.07	0.3385
202.0	100.00	0.2546

Experiment No. 11

Pure  $\text{Fe}_2\text{O}_3$  graphite

Reaction temp. =  $938^\circ\text{C}$ .

Time min	per cent reduction	$\frac{w}{a} \frac{f}{f-a}$ gm <sup>2</sup> /gm <sup>2</sup> -sec $\times 10^4$
3.0	1.24	0.4343
27.0	11.38	0.2525
69.0	20.92	0.1758
97.0	25.00	0.0852
133.0	30.73	0.2529
135.0	31.72	0.6101
141.0	38.55	1.3064
157.0	61.79	0.8687
213.0	85.00	0.3482
254.0	100.00	0.2520



C) Interpretation of ore-graphite powder mixture and pure

$\text{Fe}_2\text{O}_3$  - graphite powder mixture:

The  $\dot{w}_{a,f}$  Vs pct reduction curves for ore-graphite powder mixture (fig 6-1) and (6-2) as well as  $\text{Fe}_2\text{O}_3$  -graphite powder mix (fig 6-4) show the two stage behaviour as reported earlier by Otsuka and kunii (fig. 1-3) . The rates of the second stage are higher compared to those in the first stage. The rates do not become zero at 100 pct, reduction because of experimental errors.

Otsuka and kunii explain this enhancement of rate in the second stage as due to catalytic effect of reduced iron on the rate of gasification reaction. A confirmation of their contention was that they found the activation energy to be high (55-75) Kcal in the first stage and low (15-23 kcal) in the second stage.

Fig 6-5 shows  $\log w_{a,f}$  Vs  $\frac{1}{T}$  plots. For ore-graphite mixture, activation energy ( $E$ ) = 105 Kcal/mole at 10 pct. reduction (first stage) and  $E$  = 70 Kcal/mole for 60 pct. reduction (second stage). Noting that the activation energy of uncatalysed gasification reaction is 80-90 Kcal/mole, the following points emerge.

1. The reaction between ore and graphite powder is controlled by the rate of gasification.
2. Catalytic enhancement of rate, presumably by reduced iron is occurring in the second stage.

Fig. 6-5 also shows that the rates in ore graphite are not substantially different from those in  $\text{Fe}_2\text{O}_3$  -graphite system.

This is expected if gasification reaction is rate controlling and therefore confirms the above conclusion no. 1.

For  $\text{Fe}_2\text{O}_3$ -graphite reaction, no attempt was made to determine the activation energy since there were data only at two temperatures.

D) Interpretation for ore-pellet-graphite powder mixtures:

This differed from the ore powder-graphite powder mixture in the following respects

1. The  $w_{c,f}$  Vs pct reduction curves show one peak at less than 10 pct. reduction. Above 30 pct reduction the rates are steady and lower. Therefore these are marked by absence of the enhancement at the second stage as in the case with the powder mixture.
2. Activation energy is lower (34-Kcal/mole for 20 pct. reduction and 17 Kcal/mole for 60 pct. reduction) compared to those with powder mixtures.
3. The rate at 60 pct reduction is substantially less compared to the same for powder mixture.
4. The rates at 20 pct reduction are less at higher temperatures but more at lower temperatures compared to those for powder mixture.

The lowering of the rate may very well be explained as due to less contact surface area in the pellet graphite case. The absence of an enhanced second stage may be due to any of the followings:

1. Gasification reaction not controlling the rate
2. The gasification reaction is controlling, but either catalyzed or uncatalyzed throughout. The uncatalyzed case is ruled out because of the low activation energy.

Lowering of the activation energy may be due to:

1. Ore reduction rate controlling
2. Gasification rate controlling, but catalyzed throughout the reduction period.
3. Long range diffusion in graphite rate controlling.

In order to clarify it further literature data on rate of reduction of iron oxides by carbon monoxide was picked up from the investigations in the past.

Bicknese and clerke (18) prepared synthetic FeO (-12 to + 16 mesh) from pure  $\text{Fe}_2\text{O}_3$  and Fe, then compacted this FeO and subjected it to reduction in CO in packed bed by the thermobalance<sup>a</sup> technique. They could fit their rate data with the following equations:-

$$(1-(1-f)^{1/3})/t = (4.3 \exp(-\frac{13,800}{RT}) ) \times (\frac{C_g - C_g^e}{C_g^e}) \quad (6.11)$$

Where  $f$  = fractional reduction

$t$  = time in minutes

$C_g^e$  = equilibrium concentration of  $\text{CO}_2$  in equilibrium with  $\text{Fe}_3\text{O}_4$ -Fe.

$C_g$  = actual concentration of  $\text{CO}_2$  in the gas stream

Smith and Mckewan (15) studied the kinetics of reduction of hematite ore pellets of 1.5 - 1.9 cm diameter and porosity. @x 0.21 in pure CO and CO-H<sub>2</sub> gas mixture by single pellet thermobalance technique. They fitted their rate equation as:

$$K = \frac{R_o d_o (1 - (1 - f)^{1/3})}{t} \quad \dots\dots (16-12)$$

Where  $K$  = rate constant in mg/cm<sup>2</sup>/min

$R_o$  = original pellet radius

$d_o$  = oxide density

For pure CO,  $K = \text{Bexp.}^{-\left(\frac{8500}{RT}\right)}$  and values were 14.9 at 935°C and 18.2 at 1038°C.

Noting that in this investigation, pellet diameters were approximately 5 mm, porosity approximately 30 pct (assumed) and that there were 5 pellets in each experiment, some sample calculations were made as follows.

- i) Time taken to alter  $f$  from 0.4 to 0.8 was calculated from the equations of Bicknese and clerk as well as Smith and Mckewan. The gas was taken as pure CO.
- ii) Assuming CO/CO<sub>2</sub> ratio to be 4:1, carbon loss rate and hence  $w_{o,f}$  were calculated.
- iii) The corresponding loss of oxygen was calculated.

Results of such calculations are presented in fig. 6-5. It may be noted that the calculated rates are fairly close to those obtained from experiments. Low activation energy is also explained. Hence it is concluded that the ore reduction stage is controlling the rate of reduction between ore pellet and graphite, if not fully, at least partially.

## CHAPTER VII

### SUMMARY AND CONCLUSIONS:

- 1) Oxygen sensor was fabricated using CSZ as solid electrolyte.
- 2) Sensor performance was tested in  $O_2-N_2$  mixtures (oxygen conc. in the range 1 pct- 10 pct) and air in the temperature range of  $1050^{\circ}K - 1250^{\circ}K$ . Data obtained fall within 20 pct of those estimated from flow meter reading. In most of the cases the error was positively which indicates that the source of error may be poor electrode contact. Also at low oxygen concentration the scatter of flowmeter may be the other source of error.
- 3) Using the flowmeter and above sensor, kinetics of reduction of iron ore by carbon was investigated. -325 mesh powder and 5 mm. sintered pellets of iron ores from Rajhara mines (Durg) was used . Some experiments were also performed using pure  $Fe_2O_3$  powder. The temperature range of the experiments was  $925^{\circ}C - 1050^{\circ}C$ .
- 4) Computer calculations were executed to obtain CO fraction, pct. reduction, cumulative carbon and oxygen wt. loss, and instantaneous rates of carbon and oxygen removal.
- 5) Results indicated that the  $CO-CO_2-O_2$  equilibrium, Corresponding

to the reaction temperature remained 'frozen' even in the oxygen sensor. Therefore further calculations were done by assuming the equilibrium to be frozen. Some correction procedures were used to get the specific rate of carbon weight loss ( $\dot{W}_{c,f}$ ) and pct. reduction.

- 6) The ore powder-graphite powder mixture as well as pure  $\text{Fe}_2\text{O}_3$ , graphite mixture show two-stage behavior. Second stage show enhanced rate of reduction presumably by catalysis. Activation energy for the reaction is high. Hence gasification is concluded to be rate controlling.
- 7) The ore pellets-graphite mixtures show low activation energy and reduction rates are also lower. Assuming ore reduction stage to be rate controlling, rates of ore reduction in pure CO were calculated based on the literature information. These calculations are in good agreement with the results calculated from the experimental data. This indicates that the ore reduction step is at least partially rate controlling.

## B I B L I O G R A P H Y

1. J.B. Clegg: J. Chromatography, 52, 367 (1970),
2. B.C.H. Steele and C.B. Alcock: Trans. Met Soc AIME, 233, 1359 (1965)
3. A. Ghosh and T.B. Kings: Trans. Met. Soc. AIME, 245, 145 (1969).
4. J.P. Hoare: The Electrochemistry of oxygen, Interscience Publishers, page 146 (1968),
5. A. Ghosh: Proceedings of thermodynamic conf. held at I.I.T. Kanpur, page - 180 (1973)
- 6) Oxygen analyser: Westing house brochure no. DB 99-250.
7. Westinghouse Technical Information Reprint 6462 Westing house ENGINEER, July (1967).
8. Westinghouse Electric Corporation: (U.S. Patents: 3, 347, 767-3,400,054).
9. W. Bankloh and R. Durrer: Arch. Eisenhüttenw, 4, 455 (1963).
10. T.S. Yun: Trans. ASM, 54, 129 (1961).
11. A. Prasad and R.H. Tupkary: Proceedings of International conf. on Science and Technology. of Iron and Steel, Tokyo, Japan, 249 (1970)
12. A. Ghosh and M.C. Abrahams: NML Symposium on Science and Technology of sponge iron, Engineering world. Feb. (1973) issue.
13. Y.K. Rao: Met. Trans AIME, 2, 149 (1971).
14. B. Baldwin: J.I.S.I. London, 179, 30 (1955).
15. N.D. Smith and W.M. McKewan: The Blast Furnace, Coke Oven and Raw Materials conference, Detroit (1962)



16. R.D. Walker and D.L. Carpenter: J.I.S.I. , 208, 67 (1970).
17. S.E. Khalfalla, C.W. Schultz and T.N. Ruston: V.S. Bureau of Mines report of investigations, 6699 (1965).
18. E. Bicknese and R. Clark: Trans. IMS-AIME, 236, 2(1966).
19. S.E. Khalfalla and P.L. Weston: Jr. Trans. AIME, 239, 1494 (1967)
20. B. Stalhane and T. Malmberg: Jernkontorets Ann, 114, 1 (1930)
21. L.S. Darken and E.T. Turkdogan: Adsorption and kinetics at elevated temperatures: Heterogeneous kinetics at Elevated Temperatures (G.R. Belton, W.L. Worrd, Tds) Plenum Press, New York, 25, (1970).
22. Y.K. Rao and B.P. Jalan: The use of catalyst to enhance the rate of Boundwards Reactions in Direct Reduction Metallurgical Processes. Blast Furnace Technology, Science and Practice. (Julian Szakely Ed.) Dekker, Inc. New York. (1972).
23. P.L. Walker, Jr., M. Shelf and R.A. Anderson: 'Catalysis of Carbon Gasification'. Chemistry and physics of carbon (P.L. Walker Ed.) Marcel Dekker, Inc. New York, 4, 287 (1968).
24. Ken.ichi Otsuka and Dazoo Kunii: J. of Chemical Engg. of Japan, 2, No. 1, 45 (1969).
25. Y.K. Rao: Metallurgical Transactions AIM E, 2, -149 (1971)
26. T.P. Prasad and B.R. Sast: J. of Scientific and industrial research, 30 (10), 535 (1971)
27. T.H. Etsell and S.N. Flengas: Metallurgical Transactions Vol 3, January, 27, (1972).
28. E.T. Turkdogan and J U. Vinters: Carbon 7, 101, (1969): Carbon 8, 39 (1970.)

# APPENDIX V

## THEORETICAL CALCULATIONS FOR THE REDUCTION

### OF PELLETS ASSUMING REDUCTION STAGE TO BE

#### RATE CONTROLLING

Weight of the ore pellets = 1 gm.

Weight of the graphite  $\approx$  0.4 gm.

$W_O = \Delta f \times$  Weight of oxygen in ore pellet

$$= \Delta f \times 0.263$$

Consider the time interval during which fractional reduction ( $f$ ) changed from 0.8 to 0.4.

$f$	$1-f$	$(1-f)^{1/3}$	$\Delta(1-f)^{1/3}$	$\Delta W_O$ gms.
0.4	0.6	0.843	0.238	0.113
0.8	0.2	0.585		

$$\begin{aligned} \dot{W}_O &= \frac{\Delta W_O}{\Delta t} = \frac{\Delta W_O}{\Delta (1-f)^{1/3}} \times \frac{\Delta (1-f)^{1/3}}{\Delta t} \\ &= 0.438 \times \frac{(1-f)^{1/3}}{t} \end{aligned} \quad (1)$$

Thus by knowing  $\frac{(1-f)^{1/3}}{t}$  from literature data,  $\dot{W}_O$

can be calculated.

Now assume CO/CO<sub>2</sub> ratio ( $\gamma$ ) = 4/1

$$\text{Then, } \frac{\dot{W}_C}{\dot{W}_O} = \frac{12}{32} \times \frac{2(\gamma+1)}{\gamma+2} = \frac{12}{32} \times \frac{10}{6} = \frac{5}{8} \quad (2)$$

$$\text{Hence } \dot{W}_C = \frac{5}{8} \dot{W}_O$$

$$\text{It is already stated that } \dot{W}_{C,f} = \frac{\dot{W}_C}{\text{original wt. of carbon}} \quad (4)$$

1) Calculations assuming Bicknese and Clarke relationship to be valid.

$$\frac{1-(1-f)^{1/3}}{t} = 4.3 \exp. \left( \frac{-13,800}{RT} \right) \times \frac{C_g - C}{C_g}$$

Since the gas is assumed to be pure  $\text{CO}_2$ ,  $C = 0$ .

$$\therefore \frac{C_g - C}{C_g} = 1$$

So at the reaction temperatures, corresponding  $\frac{1-(1-f)^{1/3}}{t}$

values are known, from which  $\dot{W}_O$ ,  $\dot{W}_C$  and  $\dot{W}_{C,f}$  can be calculated.

Thus the calculated results are:

Expt. No.	Temp. °K	$\frac{\Delta(1-f)^{1/3}}{\Delta t (\text{sec}^{-1})}$	$\dot{W}_O \times 10^4$ gms/sec.	$\dot{W}_C \times 10^4$ gms/sec.	$\dot{W}_{C,f} \times 10^4$ (sec <sup>-1</sup> )
6	1327	4.10	1.80	1.125	2.812
7	1325	4.06	1.79	1.12	2.78
8	1292	3.31	1.45	0.906	2.25
9	1245	2.72	1.105	0.69	1.72

2) Calculations assuming Smith and McKewen's equation to be valid.

$$K = \frac{R_g d (1-(1-f)^{1/3})}{t}$$

$R_g$  = radius of the pellets = 0.25 cm.

$d_g$  = density of the pellets = 3.7 gms/cc

(assuming 30% porosity).

Values of K are 14.9 and 18.2 mg/cm<sup>2</sup>/min at 955°C and 1038 °C respectively.

From this data  $\frac{\ln(1-f)^{1/3}}{t}$  can be calculated at 955 °C and 1038 °C and then  $\dot{w}_O$ ,  $\dot{w}_C$  and  $\dot{w}_{c,f}$  have been obtained as shown earlier.

Thus the results obtained are :

Temp. °K	$\frac{\ln(1-f)^{1/3}}{t}$ (Sec <sup>-1</sup> )	$\dot{w}_O \times 10^4$ gms/sec	$\dot{w}_C \times 10^4$ gms/sec.	$\dot{w}_{c,f} \times 10^4$ sec <sup>-1</sup>
1228	2.68	1.175	0.734	1.835
1311	3.28	1.438	0.899	2.247

A45551

Th.

A45551

669 141

Date Slip

G5617

This book is to be returned on the  
date last stamped

CD 6729

ME-1878-M-GOK-FAR